



Release 295 Tesla, Quadro, & NVS Professional Drivers for Windows - Version 297.03

RN-WQ29703-01_v01 | July 17, 2012
Windows 7, Windows Vista

Release Notes



TABLE OF CONTENTS

1	Introduction to Release Notes	1
	Structure of the Document	1
	Changes in this Edition	1
2	Release 295 Driver Changes	2
	Version 297.03 Highlights	3
	Existing Support	3
	What's New in Release 295	3
	What's New in Version 297.03	5
	Discontinued Features in this Release	5
	Limitations in This Release	6
	Advanced Instructions for this Release	7
	Using Mosaic Technology	7
	Turning Off V-Sync to Boost Performance	8
	NVIDIA Application Configuration Engine (ACE)	8
	SLI Multi-OS - GPU Assignment in System Virtualization	9
	Changes in Version 297.03	1
	Changes in Version 296.88	1
	Changes in Version 296.70	1
	Changes in Version 296.35	2
	Changes in Version 295.73	3
	Open Issues in Version 297.03	4
	Windows Vista/Windows 7 32-bit Issues	4
	Windows Vista/Windows 7 64-bit Issues	4
	Not NVIDIA Issues	6
	Windows Vista Considerations	6
	Windows 7 Considerations	6
	Unsupported Features	7
	OpenGL Application Issues	9
	Application Issues	9
	Other Issues	9
	Known Product Limitations	11
	Some APIs do not Report Total Available Graphics Memory Correctly	11

TABLE OF CONTENTS

Using HDMI/DisplayPort Audio with Displays that have a High Native Resolution	12
Using HDMI/DisplayPort Displays that do not Support Audio	14
Using HDMI/DisplayPort Audio in Dualview or Clone Mode Configurations	15
GPU Runs at a High Performance Level (full clock speeds) in Multi-display Modes	15
Aero Must be Enabled for Windowed SLI AFR Mode Under Vista	15
SLI Connector Requirement on NVIDIA Quadro SLI Cards	15
Applying Workstation Application Profiles	16
1280x1024 @ 60 Hz not Available on BenQ FP241W Monitors	16
Gigabyte GA-6BX Motherboard	16
3 The Release 295 Driver	17
Hardware and Software Support	17
Supported Operating Systems	17
Supported NVIDIA Products	18
Supported Languages	23
Driver Installation	24
Minimum Hard Disk Space	24
Before You Begin	24
Installation Instructions	24
Appendix A: Mode Support for Windows	25
General Mode Support Information	26
Understanding the Mode Format	27
Tesla, Quadro, & NVS GPUs	28
Modes Supported by TV Encoders	30
Appendix B: NVIDIA Tesla Compute Cluster Mode	31
About Tesla Compute Cluster Mode	31
TCC Overview	31
Running CUDA Applications	32
Operating on Systems with non-TCC NVIDIA GPUs	33
Setting TCC Mode for Tesla Products	33

LIST OF TABLES

Table 2.1	Quadro Products Offering NVIDIA Mosaic	7
Table 3.1	Supported NVIDIA Quadro & NVS Products	18
Table 3.2	Supported NVIDIA Quadro G-Sync Products	20
Table 3.3	Supported NVIDIA Quadro G-Sync II Products	20
Table 3.4	Supported NVIDIA Quadro SDI Products	20
Table 3.5	Supported NVIDIA Quadro Plex Products.....	21
Table 3.6	Supported NVIDIA Quadro Blade/Embedded Graphics Board Series	21
Table 3.7	Supported NVIDIA Tesla Products	22
Table A.1	Modes Supported for High Resolution Displays	26
Table A.2	Non-standard Modes Supported	26
Table A.3	Mode Support for S-Video and Composite Out	30
Table A.4	Mode Support for Component YPrPb Out and DVI Out.....	30
Table B.1	Default TCC Mode for Tesla Products	33

01 INTRODUCTION TO RELEASE NOTES

This edition of *Release Notes* describes the Release 295 family of NVIDIA Tesla, Quadro, and NVS Professional Drivers for Microsoft® Windows® Vista/Windows 7. NVIDIA provides these notes to describe performance improvements and bug fixes in each documented version of the driver.

Structure of the Document

This document is organized in the following sections:

- ▶ “Release 295 Driver Changes” on page 2 gives a summary of changes, and fixed and open issues in this version.
- ▶ “The Release 295 Driver” on page 17 describes the NVIDIA products and languages supported by this driver, the system requirements, and how to install the driver.
- ▶ “Mode Support for Windows” on page 25 lists the default resolutions supported by the driver.
- ▶ “NVIDIA Tesla Compute Cluster Mode” on page 31 describes the Tesla Compute Cluster mode.

Changes in this Edition

This edition of the *Release Notes* for Windows Vista/Windows 7 includes information about NVIDIA graphics driver version 297.03, and lists changes made to the driver since version 290.37 and 276.52. These changes are discussed beginning with the chapter “Release 295 Driver Changes” on page 2.

02 RELEASE 295 DRIVER CHANGES

This chapter describes open issues for version 297.03, and resolved issues and driver enhancements for versions of the Release 295 driver up to version 297.03. The chapter contains these sections:

- ▶ “Version 297.03 Highlights” on page 3
- ▶ “Advanced Instructions for this Release” on page 7
- ▶ “Changes in Version 297.03” on page 1
- ▶ “Changes in Version 296.88” on page 1
- ▶ “Changes in Version 296.70” on page 1
- ▶ “Changes in Version 296.35” on page 2
- ▶ “Changes in Version 295.73” on page 3
- ▶ “Open Issues in Version 297.03” on page 4
- ▶ “Not NVIDIA Issues” on page 6
- ▶ “Known Product Limitations” on page 11

Version 297.03 Highlights

This section provides highlights of version 297.03 of the NVIDIA Release 295 Driver for Windows Vista/Windows 7.

- ▶ Existing Support
- ▶ What's New in Release 295
- ▶ What's New in Version 297.03
- ▶ Discontinued Features in this Release
- ▶ Limitations in This Release

Existing Support

This release supports the following APIs:

- ▶ Open Computing Language (OpenCL) 1.1 in Quadro FX Series x700 and newer as well as the FX4600 and FX5600.
- ▶ OpenGL 4.2
- ▶ DirectX 11
- ▶ CUDA 4.1

What's New in Release 295

The section summarizes the following driver changes in Release 295 since Release 275:

ODE Driver

The R295 drivers are the second 'Optimal Drivers for Enterprise', a release dedicated to relatively long term stability for ISV certification, OEMs, and Enterprise customers.

Product Support

- ▶ Added support for the NVIDIA Tesla M2075.

NVIDIA Control Panel

Manage 3D Settings - Profile Notification

- ▶ Added the *Preferences* tab which lets the user control the application profile notification feature.

Upon launch of a windowed 3D program, this feature causes a popup to appear notifying the user which workstation application profile was applied.

Adjust Desktop Color Settings page

- ▶ Color settings are now preserved across system reboots, logins, and fast user switching for GPU/displays that support HDMI infoframes.

Set Up Multiple Displays page

- ▶ Slight change in the menu process for setting up Clone mode—displays are now added to a 'Clone group'.

OpenGL

- ▶ Added support for OpenGL 4.2

CUDA

- ▶ Added support for CUDA 4.1 toolkit

OpenCL

Added support for the Open Computing Language (OpenCL) 1.1 in Quadro FX Series x700 and newer as well as the FX4600 and FX5600.

GPUDirect™ for Video

- ▶ Added **GPUDirect™ for Video** to support professional video applications. Visit <http://developer.nvidia.com/nvidia-gpudirect%E2%84%A2-video> for information about GPUDirect™ for Video.

NVIDIA Mosaic

- ▶ Added support for 8-display topologies that use higher resolution displays, such as 2560x1600

NVIDIA WMI 2.4

- ▶ Added functions to configure Mosaic topologies
- ▶ Added function to control V-Sync
- ▶ Added function to set EDIDs
- ▶ Added property to query GPU available memory
- ▶ Added function to enable/disable the nView Desktop Manager, and property to get the current nView state.

256GB Virtual Space

- ▶ OpenGL and CUDA users can now take full advantage of applications that utilize 256GB of system memory

Digital Video Pipeline

- ▶ Added new API's for supporting low latency access to SDI video hardware

What's New in Version 297.03

- ▶ Added support for the following products:
 - Quadro 410
 - NVS 310
- ▶ This driver offers performance improvements over previous driver versions, including workstation compatibility fixes.
- ▶ See [“Changes in Version 297.03” on page 1](#) for a list of changes and resolved issues in this driver version.

Discontinued Features in this Release

- ▶ The NVIDIA® AutoCAD Performance driver is no longer integrated in the graphics driver.

Standalone versions or version updates can still be downloaded from the NVIDIA driver download page.

- ▶ The following features are removed from the NVIDIA Control Panel
 - The Views option
You no longer need to select between Standard and Advanced views for many NVIDIA Control Panel controls.
 - The Profiles menu

Limitations in This Release

The following are features that are not currently supported or have limited support in this driver release:

▶ **NvCPL API Support**

The NvCPL API support is discontinued for Windows 7 and later. Customers are advised to switch to NVAPI.

▶ **Video Memory Support**

For Windows 7 and Windows Vista 64-bit, this driver recognizes up to the total available video memory on Quadro cards for Direct3D and OpenGL applications.

For Windows 7 and Windows Vista 32-bit, this driver recognizes only up to 4 GB of video memory on Quadro cards for DirectX, OpenGL, and CUDA applications.

▶ **NVIDIA Control Panel Display Category**

- The Graph tab on the Adjust Desktop Color Settings page is not available.

Advanced Instructions for this Release

This section clarifies instructions for successfully accomplishing the following tasks:

- ▶ Using Mosaic Technology
- ▶ Turning Off V-Sync to Boost Performance
- ▶ NVIDIA Application Configuration Engine (ACE)
- ▶ SLI Multi-OS – GPU Assignment in System Virtualization

Using Mosaic Technology

This release contains NVIDIA's Mosaic Technology, which lets you span 2-4 displays across a single desktop for select non-SLI Quadro products and configurations. The following table lists the products and configurations that support NVIDIA Mosaic in this release:

Table 2.1 Quadro Products Offering NVIDIA Mosaic

Products	Notes
Quadro 6000, 5000	SLI GPUs in a Quadro SLI-certified workstation will utilize Premium Mosaic automatically.
Quadro 4000, 2000, 600	
Quadro FX 5800	SLI GPUs in a Quadro SLI-certified workstation will utilize Premium Mosaic automatically.
Quadro FX 4800, 3800, 1800, 580, 380LP, 380	
Quadro NVS 450, 420, 295, 290	
NVS 300	

- ▶ NVIDIA Mosaic is available only under Windows 7.

Turning Off V-Sync to Boost Performance

To get the best benchmark and application performance measurements, turn V-Sync off as follows:

- 1 Open the NVIDIA Control Panel and make sure that *Advanced Settings* is selected from the control panel tool bar.
- 2 From the *Select a Task* pane, under 3D Settings, click **Manage 3D Settings**, then click the Global Settings tab.
- 3 From the Global presets pull-down menu, select **Base profile**.
- 4 From the Settings list box, select **Vertical sync** and change its value to **Force off**, then click **Apply**.
- 5 From the Global presets pull-down menu, select **3D App - Default Global Settings** (the driver's default profile) or use the application profile that matches the application you are testing, then click **Apply**.

Be sure to close the NVIDIA Control Panel completely —leaving it open will affect benchmark and application performance.

NVIDIA Application Configuration Engine (ACE)

This driver includes the NVIDIA Application Configuration Engine (ACE), which automatically detects the workstation application and configures the appropriate profile settings in the NVIDIA Control Panel.

See the *NVIDIA Quadro Professional Drivers: NVIDIA Control Panel Quick Start Guide* for more information about this feature.

SLI Multi-OS - GPU Assignment in System Virtualization

On systems with two supported graphics cards installed, this driver supports a system virtualization tool's ability to directly assign a GPU to a guest virtual machine (VM). This direct assignment allows the host and guest VM to each run on their own operating system and with their own GPU and driver.

▶ **Supported Virtualization Software:** Parallels Workstation Extreme

▶ **Supported Graphics Cards**

Up to two different models can be used in a system, from among the following:

- Quadro 6000
- Quadro 5000
- Quadro 4000
- Quadro 2000
- Quadro FX 5800
- Quadro FX 4800
- Quadro FX 3800

▶ **Video BIOS Requirement**

- The graphics card assigned to the guest VM needs video BIOS version 62.00.39.00.00 or later.

For a list of SLI Multi-OS certified workstations, virtualization software, and OS combinations, please see http://www.nvidia.com/object/sli_multi_os.html .

Changes in Version 297.03

The following sections list the important changes and the most common issues resolved since driver version 296.88.

- ▶ CUDA: Crash occurs during CUDA shutdown at memblockFree().
- ▶ Softimage: When using the High Quality Viewport, a timeout leading to a driver crash occurs if it takes more than 2 seconds to draw a single frame.
- ▶ Quadro Fermi: OpenGL application hangs in glLinkProgram.
- ▶ Quadro 6000/FX 5800, RTT DeltaGen: The application crashes when CUDA is switched off.
- ▶ Quadro 5000, SceniX: OpenGL driver crashed when using SceniX with Dassault Systemes CATIA - Compatible profile.
- ▶ Quadro 4000, Maya: The application crashes in glDrawElements when using ramp texture in VP2.0 mode
- ▶ Quadro 4000, Tebis CAD/CAM: "NVIDIA OpenGL driver lost connection error" occurs.
- ▶ Quadro 4000, NX: Preselection highlighting causes the NVIDIA driver to crash and the application to exit.
- ▶ Quadro 2000: OpenGL sample crashes in glDrawElements when using VBO.
- ▶ Quadro 2000, FEMAP: Window compositor issues occur within Femap.
- ▶ Quadro FX 3800: Software tool is needed to programmatically configure Video Editing Mode.
- ▶ [Multi-GPU]: RTT DeltaGen: On dual-GPU systems with one ScaleClient per GPU, a blue-screen crash occurs when starting up scaleconfig with the NVIDIA SwapAPICall enabled.
- ▶ 2xQuadro 6000, G-Sync: Quantum 3D Mantis—there are performance issues in the application.

Changes in Version 296.88

The following sections list the important changes and the most common issues resolved since driver version 296.70.

- ▶ Cinema 4D: The driver crashes during `glDrawElements` while running the application.
- ▶ Stereoscopic 3D Apps: Black borders appear on one stereo eye, or both eyes if “Always run in Stereo mode” is set.
- ▶ Avid Studio 2: With 3D Discovery mode set from the NVIDIA Control Panel, the display has a red tint.
- ▶ Quadro 6000: Scale clients hang when trying to join `NV_swapgroup` in Mosaic.
- ▶ Quadro 2000/4000/5000: Data errors occur when loading the LUT.
- ▶ Quadro 5000/FX 4800, Avid MediaComposer: The application loses swap-sync, resulting in on-screen tearing and degraded performance.
- ▶ Quadro FX 1800. Revit 2013: Semi-transparent material appears over elements when the material is positioned behind those elements.

Changes in Version 296.70

The following sections list the important changes and the most common issues resolved since driver version 296.35.

- ▶ Allplan 2013: Application profile added to the NVIDIA Control Panel.
- ▶ Quadro SDI: Added NVAPI control to enable/disable HANC blanking on repeat frames.
This feature prevents audio glitches in the event that an application fails to send a frame to the SDI device in time. Requires Quadro SDI output board firmware version 3.0A.
HANC blanking is enabled by default. To disable HANC blanking, an application must use NVAPI to set the "enableAudioBlanking" flag to 0 in NVVIOOUTPUTCONFIG_V3.
- ▶ Quadro 6000, Cinema 4D: The application locks when glMapBuffer performed after glGetTexImage.
- ▶ Quadro 6000, Cinebench: The application run slowly.
- ▶ Quadro 6000, TouchDesigner: When calling glReadPixels() with a floating point datatype, the float values are clamped.
- ▶ Quadro 2000: Opticore Visualizer 2010–Display driver stops working.
- ▶ Quadro FX 5500: NX– OpenGL issue occurs where two-sided light is not applied when rendering to the front buffer while MSAA is enabled.
- ▶ Quadro FX 4000: Opticore Visualizer–the application slows or lags when the camera gets close to the model.
- ▶ Quadro FX 500, NX: Two-sided light is not applied when rendering to the front buffer.

Changes in Version 296.35

The following sections list the important changes and the most common issues resolved since driver version 295.73.

- ▶ NX6—the application exits at model load.
- ▶ VideoLiteTest – the application stutters when the decoder calls IDirectXVideoDecoderService::CreateVideoDecoder on the GPU.
- ▶ Quadro 5000: Creo View—'memcpy' exception occurs when loading ECAD design data into the application.
- ▶ Quadro 4000/FX 1800M: glLineWidth in OpenGL 3.2 core context fails.
- ▶ Quadro 1000M: NX—notes aren't highlighted when moving the cursor over them.
- ▶ Quadro Fermi: 10bpc banding occurs with Aero enabled on 10-bpc grayscale packed DVI monitors.
- ▶ Quadro 6000: Black screen occurs when using Premium Mosaic with the Video Editing profile.
- ▶ Quadro 6000: Cinema 4D—3D Vision doesn't work properly.
- ▶ Quadro FX 4800: TouchDesigner—screen corruption occurs when using the NVIDIA Control Panel->Manage 3D Settings->Video Editing preset.

Changes in Version 295.73

The following sections list the important changes and the most common issues resolved since driver version 290.37.

- ▶ Maya: call to `glDrawElements()` causes memory corruption.
- ▶ RTT-DeltaGen—certain scenes experience unstable frame rates.
- ▶ Optimus notebook: Revit Architecture2012—the application does not refresh after it is minimized and then maximized.
- ▶ Quadro 6000: Graphics performance is slow to get up to speed after resuming from power save states.
- ▶ Quadro FX 5800: RTT DeltaGen—frame rendering slows down at high AA settings and full HD resolution.

The following sections list the important changes and the most common issues resolved since driver version 276.52.

- ▶ MAXON application profile: CINEMA 4D Benchmark Win32/64.exe added.
- ▶ CATIA: poor performance when run at high performance and high AA settings.
- ▶ Quadro 5000/2000/600: PetroMod—when switching between maps (rendered via VBO), occasionally the new maps are not rendered completely and parts of the previous map remain.
- ▶ Quadro 1000M: NX—notes aren't highlighted when moving the cursor over them.
- ▶ Quadro 6000: Graphics performance is slow to get up to speed after resuming from power save states.
- ▶ Quadro 4000: The driver stops working for the Quadro 4000 after updating the drivers for the Quadro FX 1800.
- ▶ Quadro FX 4800: Maya —back side of the sphere has a black area that is not supposed to be there.

Open Issues in Version 297.03

As with every released driver, version 297.03 of the Release 295 driver has open issues and enhancement requests associated with it. This section includes lists of issues that are either not fixed or not implemented in this version. Some problems listed may not have been thoroughly investigated and, in fact, may not be NVIDIA issues. Others may have workaround solutions.

- ▶ [“Windows Vista/Windows 7 32-bit Issues”](#) on page 4
- ▶ [“Windows Vista/Windows 7 64-bit Issues”](#) on page 4

Windows Vista/Windows 7 32-bit Issues

- ▶ Reduced performance is experienced with Release 295 drivers compared to the previous driver release.
- ▶ Cinema 4D–performance improvements are requested.
- ▶ NVIDIA Control Panel: Pro E Wildfire 5–the application doesn’t appear in the NVIDIA Control Panel->Manage 3D Settings page ‘show only programs found on this computer’ list.
- ▶ nView Desktop Manager needs the same functionality as provided by the Hummingbird Exceed Virtual Desktop style window management.

Windows Vista/Windows 7 64-bit Issues

- ▶ Reduced performance is experienced with Release 295 drivers compared to the previous driver release.
- ▶ NVIDIA Control Panel: Pro E Wildfire 5–the application doesn’t appear in the NVIDIA Control Panel->Manage 3D Settings page ‘show only programs found on this computer’ list.
- ▶ Siemens Tecnomatix: The test fails.
- ▶ RTT DeltaGen: Application performance drops. [1012116]
- ▶ Cinema 4D–performance improvements are requested.
- ▶ nView Desktop Manager needs the same functionality as provided by the Hummingbird Exceed Virtual Desktop style window management.
- ▶ MicroStation (DirectX 11)– ‘Driver not responding’ errors occur.
- ▶ Quadro 6000, Lenovo D30: The driver stops working while some applications are running.
- ▶ 2xQuadro 6000: Desktop performance lags when using two GPU's after performing an Express installation.
- ▶ Quadro 6000/5000: clCreateFromGLBuffer returns CL_OUT_OF_HOST_MEMORY.

- ▶ Quadro 6000: OpenCL/OpenGL interoperability performance suffers with `clEnqueueReleaseGLObjects`.
- ▶ Quadro 6000, Tesla C2070, RTT Deltagen: GPU raytracer hangs when switching the Tesla C2075 to ECC mode.
- ▶ Quadro 4000/2000, PTC Creo APC: Application performance drops.
- ▶ Quadro 4000, DecisionSpace Desktop: The application exits with a “Driver not responding” message indicating NVIDIA "error code 8". Quadro FX 5600, 3dsmax FumeFX: Volume textures with non-power-2 3D textures appear with incorrect pitch.
- ▶ Quadro FX 4600, HyperMesh: The application panel window (within the standalone application or the desktop client) comes up blank or crashes.
- ▶ Quadro FX 580, Creo View: During a compare operation, an NVIDIA OpenGL error message appears pointing to P-buffer `glReadPixels` calls.
- ▶ [SLI], Quadro FX 4800: “Link lost” error occurs when playing Blu-ray disk using Cyberlink PowerDVD on a DP2DVI (dual) connected display.

Not NVIDIA Issues

This section lists issues that are not due to the NVIDIA driver as well as features that are not meant to be supported by the NVIDIA driver for Windows Vista/Windows 7.

- ▶ “Windows Vista Considerations” on page 6
- ▶ “Windows 7 Considerations” on page 6
- ▶ “Unsupported Features” on page 7
- ▶ “OpenGL Application Issues” on page 9
- ▶ “OpenGL Application Issues” on page 9
- ▶ “Application Issues” on page 9
- ▶ “Other Issues” on page 9

Windows Vista Considerations

These are behaviors that may be different from Windows XP and are related directly to the Windows Vista operating system.

- ▶ **Gamma ramps are inconsistent between single and two-headed systems.**
- ▶ **NVIDIA TurboCache**

Windows Vista now controls the allocation of system memory to the GPU for TurboCache functions. The Windows Vista Display Properties pages show the shared system memory (SSM), or how much memory is allocated for NVIDIA GPUs to use for TurboCache.

For more information on graphics memory reporting under Windows Vista, visit <http://www.microsoft.com/whdc/device/display/graphicsmemory.mspx>.

Windows 7 Considerations

Windows DWM Disabled for SLI Mosaic Mode

Due to compatibility issues, when using SLI Mosaic mode the driver turns off the Windows 7 Desktop Window Manager (DWM). As a result, DWM-managed desktop features such as Windows Aero or Windows Flip 3D will not be available.

Hotplug Action

Unlike the hotplug activity under Windows Vista, the default settings are not applied when a new display is hotplugged, and there is no message balloon alert stating that a new display was detected. Under Windows 7, all display connection and detection events are handled through the Windows 7 Connecting and Configuring Displays (CCD) mechanism.

NVIDIA Control Panel Rotate Display Page

The rotation radio button labels are changed slightly under Windows 7 to be consistent with the Microsoft panel

Table 2.1 NVIDIA Control Panel Rotation Page Radio Buttons

Clockwise Rotation	Windows 7 Label	Windows Vista Label
0 degrees	Landscape	No rotation (Landscape)
90 degrees	Portrait	90 degrees to the right (Inverted Portrait)
180 degrees	Landscape (flipped)	180 degree rotation (Inverted landscape)
270 degrees	Portrait (flipped)	90 degrees to the left (Portrait)

Limitation

- ▶ When switching the refresh rate from 59 Hz to 60Hz, the refresh rate remains at 59 Hz.
See the Microsoft KB article KB2006076 at <http://support.microsoft.com/kb/2006076>.

Unsupported Features

The following are features and functionality that were available in driver releases supporting Windows XP, but are not—and will not be—available in driver releases for Windows Vista:

- ▶ **High resolution scaling desktop (HRSD)**
- ▶ **MultiView Display Mode** (for NVIDIA Quadro NVS graphics cards)
- ▶ **NVKeystone**
- ▶ **Unified back buffer (UBB) controls**
- ▶ **OpenGL Video Overlays**
This is an operating system limitation.
- ▶ **Overclocking**
GPU overclocking is no longer supported in the default GPU driver control panel. This feature is available in the NVIDIA System Tools software, which you can download from NVIDIA.com.
- ▶ **GPU Temperature Monitoring**
Temperature monitoring is no longer supported in the default GPU driver control panel. This feature is available in the NVIDIA System Tools software, which you can download from NVIDIA.com.
- ▶ **AGP Settings Adjustment**

- ▶ **Video Zoom**
- ▶ **Pan & Scan** - the process of panning across the desktop in order to display a desktop on a monitor with lower resolution
- ▶ **Per-display Desktop Color Setting Adjustments**

For Clone mode, the desktop color setting adjustments through the NVIDIA Control Panel can only be made across all displays in a system, and not on a per-display basis.
- ▶ **Per-display Video Color Setting Adjustments**

For Dualview mode, the video color setting adjustments through the NVIDIA Control Panel can only be made across all displays in a system, and not on a per-display basis.
- ▶ **Edge Blending**
- ▶ **Run display optimization wizard**
- ▶ **Run multiple display wizard**
- ▶ **Run television setup wizard**
- ▶ **nView Horizontal and Vertical Span Modes**

Due to architectural changes in the new Windows Vista Window Display Driver Model (WDDM), span mode is available only with NVIDIA Mosaic Technology.
- ▶ **Display/Connection Wizard** (such as was provided with Windows Media Center Edition)
- ▶ **DVD/MPEG Extensions** (such as was provided with Windows Media Center Edition)
- ▶ **Audio Extensions** (such as was provided with Windows Media Center Edition)

OpenGL Application Issues

The following are known compatibility issues for OpenGL applications developed under Windows XP:

- ▶ Mixed GDI and OpenGL rendering does not work.
 - A number of applications use GDI to render UI components and object highlighting. This is not supported in the Windows Vista driver model.
 - NVIDIA recommends converting GDI rendering to OpenGL.
 - The following are some applications that are known to have this issue:
 - Maya 7.01
- ▶ Applications, Tools, and Benchmarks not Supported Under Windows Vista
 - GLperf
 - 3ds max 8 (later releases may be supported)
 - CATIA V5R15 (V5R16 is supported)
 - PTC's CDRS 2001
- ▶ Front buffered rendering may be slow, especially when DWM is enabled.
 - Flushing the rendering queue while rendering to the front buffer may cause the window manager to recomposite. Applications should therefore minimize the frequency with which they flush the rendering queue.

Application Issues

- ▶ Softimage–The application crashes when thumbing the CgFX scene model while in wireframe display mode.
- ▶ Solidworks 2009–Application profile is not shown in the NVIDIA Control Panel when SolidWorks 2009 is installed.
 - This is an issue with the application shortcut.*
- ▶ ArchiCAD–the driver crashes when navigating 3D shadows.
- ▶ ArchiCAD12–OpenGL speed is half as fast on Windows Vista than on Windows XP.
- ▶ CATIA V5R20–not all drawing elements appear if the drawing is created using Approximate mode.

Other Issues

- ▶ All older drivers from other vendors must be uninstalled first.
- ▶ The Windows Vista display mode switches from Aeroglass to Basic when a quad-buffer for stereo is created.
- ▶ Quad-buffered windowed stereo is only supported with Aeroglass turned off.

- ▶ The NVIDIA Control Panel->Set Up Multiple Displays page does not provide the capability of setting the dual monitor order under Windows Vista as it does under Windows XP.

This capability is provided through the Windows Vista Display Properties Settings page.

Known Product Limitations

This section describes problems that will not be fixed. Usually, the source of the problem is beyond the control of NVIDIA. Following is the list of problems and where they are discussed in this document:

- ▶ “Some APIs do not Report Total Available Graphics Memory Correctly” on page 11
- ▶ “Using HDMI/DisplayPort Audio with Displays that have a High Native Resolution” on page 12
- ▶ “Using HDMI/DisplayPort Displays that do not Support Audio” on page 14
- ▶ “Using HDMI/DisplayPort Audio in Dualview or Clone Mode Configurations” on page 15
- ▶ “GPU Runs at a High Performance Level (full clock speeds) in Multi-display Modes” on page 15
- ▶ “Aero Must be Enabled for Windowed SLI AFR Mode Under Vista” on page 15
- ▶ “SLI Connector Requirement on NVIDIA Quadro SLI Cards” on page 15
- ▶ “Applying Workstation Application Profiles” on page 16
- ▶ “1280x1024 @ 60 Hz not Available on BenQ FP241W Monitors” on page 16
- ▶ “Gigabyte GA-6BX Motherboard” on page 16

Some APIs do not Report Total Available Graphics Memory Correctly

Background-TAG Memory

In the Windows Display Driver Model (WDDM), Total Available Graphics (TAG) memory is reported as the sum of

- Dedicated Video Memory (video memory dedicated for graphics use)
- Dedicated System Memory (system memory dedicated for graphics use), and
- Shared System Memory (system memory shared between the graphics subsystem and the CPU).

The values for each of these components are computed according to WDDM guidelines when the NVIDIA Display Driver is loaded.

Issue

NVIDIA has found that some TAG-reporting APIs represent video memory using 32-bits instead of 64-bits, and consequently do not properly report available graphics memory when the TAG would otherwise exceed 4 gigabytes (GB). This results in under reporting

of available memory and potentially undesirable behavior of applications that rely on these APIs to report available memory.

The reported memory can be severely reduced. For example, 6 GB might be reported as 454 MB, and 8 GB might be reported as 1259 MB.

NVIDIA Action for non-Quadro based Systems

Recent NVIDIA display drivers constrain TAG memory to just below 4 GB¹. In these scenarios, the Shared System Memory component of TAG is limited first, before limiting Dedicated Video Memory. This is a policy decision within the driver.

This results in reliable reporting of sub-4 GB TAG memory.

NVIDIA Action for Quadro-based Systems

The unfortunate side effect of constraining TAG on systems with larger amounts of video and system memory is that memory which otherwise would be available for graphics use is no longer available. Since shared system memory is limited first, driver components and algorithms utilizing shared system memory may suffer performance degradation when TAG is constrained.

Since this and similar scenarios are prevalent in many Workstation applications, but less so in more mainstream Consumer applications, the NVIDIA driver now avoids constraining TAG on Quadro-based systems (which are used primarily in the Workstation applications).

This has been a conscious decision by NVIDIA to trade off better Workstation application performance for potentially less desirable performance on applications which rely on the suspect memory reporting APIs.

Using HDMI/DisplayPort Audio with Displays that have a High Native Resolution

To use HDMI/DisplayPort audio with some displays that have a native resolution higher than 1920x1080, you must set the display to a lower HD resolution.

Some HDMI TV's have a native resolution that exceeds the maximum supported HD mode. For example, TVs with a native resolution of 1920x1200 exceed the maximum supported HD mode of 1920x1080.

Applying this native mode results in display overscan which cannot be resized using the NVIDIA Control Panel since the mode is not an HD mode.

1. The WDDM guidelines dictate minimum and maximum values for the components, but the display driver may further constrain the values that are reported (within the allowed minimum and maximum).

To avoid this situation and provide a better user experience, the driver treats certain TVs—such as the Viewsonic VX2835wm and the Westinghouse LVM- 37w3—as a DVI monitor when applying the native mode. Because the driver does not treat the TV as an HDMI in this case, the HDMI audio is not used.

Using HDMI/DisplayPort Displays that do not Support Audio

Some HDMI/DisplayPort displays do not support audio, or have issues with Quadro FX family and earlier NVIDIA graphics cards.

The NVIDIA driver attempts to identify such displays and automatically disables the audio. For example, the NVIDIA driver disables HDMI audio for all Philips HDMI TVs, as these have been identified as having issues with Quadro FX family and earlier NVIDIA graphics cards.

There may be cases where either the driver disables audio even though there is no problem, or does not disable the audio when in fact the audio does not work. The following sections describe these situations and provides guidance for handling them.

Corrupted video and no audio

The driver has not disabled audio and the display's audio signal is incompatible with the graphics card, causing video corruption.

With a different display connected in order to establish video, disable audio for the HDMI display using the NVIDIA Control Panel-> Change Resolution page. From the connector list, select **HDMI-HDTV (Audio Disabled)**.

Video but no audio

- ▶ Check the connector list on the NVIDIA Control Panel->Change Resolution page.
- ▶ If **HDMI-HDTV (Audio Disabled)** is selected and you want to test whether your HDMI audio does, in fact, work, then select **HDMI-HDTV (Audio Enabled)** and the driver will prompt you with instructions for testing HDMI audio with the display.
- ▶ If **HDMI-HDTV (Audio Enabled)** is selected, then the driver has not successfully detected that an incompatible display is connected.

Future driver versions will properly identify such displays and disable audio.

- ▶ If there is no HDMI connector option in the NVIDIA Control Panel->Change Resolution page, the display does not support audio and has properly reported this to the NVIDIA driver.

Using HDMI/DisplayPort Audio in Dualview or Clone Mode Configurations

Two Audio-enabled Ports

In a multi-display configuration where both HDMI/DisplayPort audio ports are enabled, only the primary display will provide the audio.

One Audio-enabled Port

In a multi-display configuration where only one audio port is enabled, such as when one display is a DVI display, then the HDMI/DisplayPort display can provide the audio whether is it the primary or secondary display.

GPU Runs at a High Performance Level (full clock speeds) in Multi-display Modes

This is a hardware limitation and not a software bug. Even when no 3D programs are running, the driver will operate the GPU at a high performance level in order to efficiently drive multiple displays. In the case of SLI or multi-GPU PCs, the second GPU will always operate with full clock speeds; again, in order to efficiently drive multiple displays. Today, all hardware from all GPU vendors have this limitation.

Aero Must be Enabled for Windowed SLI AFR Mode Under Vista

Windows 7 Aero must be enabled in order to achieve SLI acceleration using windowed AFR mode.

SLI Connector Requirement on NVIDIA Quadro SLI Cards

The SLI connector that links two SLI cards is needed for proper SLI operation. However, the connector can be removed if you do not intend to enable SLI mode. If you remove the connector, then you must make sure that SLI mode is disabled from the NVIDIA control panel. Enabling SLI mode without the SLI connector installed will result in video corruption.

Applying Workstation Application Profiles

► Background

The workstation application profiles are software settings used by the NVIDIA Display Drivers to provide optimum performance when using a selected application. The profile also works around known application issues and bugs.

If there is an available setting for an application, it should be used, otherwise incorrect behavior or reduced performance is likely to occur.

► Issues

Configuration changes require that you restart the application.

Once an application is running, it does not receive notification of configuration changes. Therefore, if you change the configuration while the application is running, you must exit and restart the application for the configuration changes to take effect.

1280x1024 @ 60 Hz not Available on BenQ FP241W Monitors

Even though the monitor EDID lists 1280x1024 @ 60 Hz, the screen turns blank when using an HDMI connection. This is an issue with the monitor and not the NVIDIA driver.

Because of this issue with the monitor, the NVIDIA driver blocks the problem mode (1280x1024 @ 60 Hz) and makes it unavailable.

Gigabyte GA-6BX Motherboard

This motherboard uses a Linfinity regulator on the 3.3-V rail that is rated to only 5 A—less than the AGP specification, which requires 6 A. When diagnostics or applications are running, the temperature of the regulator rises, causing the voltage to the NVIDIA chip to drop as low as 2.2 V. Under these circumstances, the regulator cannot supply the current on the 3.3-V rail that the NVIDIA chip requires.

This problem does not occur when the graphics board has a switching regulator or when an external power supply is connected to the 3.3-V rail.

03 THE RELEASE 295 DRIVER

This chapter covers the following main topics:

- ▶ “Hardware and Software Support” on page 17
- ▶ “Driver Installation” on page 24

Hardware and Software Support

Supported Operating Systems

The Release 295 driver, version 297.03, has been tested with

- ▶ Microsoft Windows® 7, and supports both 32-bit and 64-bit versions.
- ▶ Microsoft Windows® Vista, and supports both 32-bit and 64-bit versions of Windows Vista Editions:
 - Windows Vista Home Basic
 - Windows Vista Home Premium
 - Windows Vista Business
 - Windows Vista Enterprise Edition
 - Windows Vista Ultimate

Supported NVIDIA Products

The following tables list the NVIDIA products supported by the Release 295 driver, version 297.03.

- ▶ Table 3.1, “Supported NVIDIA Quadro & NVS Products” on page 18
- ▶ Table 3.2, “Supported NVIDIA Quadro G-Sync Products” on page 20
- ▶ Table 3.3, “Supported NVIDIA Quadro G-Sync II Products” on page 20
- ▶ Table 3.4, “Supported NVIDIA Quadro SDI Products” on page 20
- ▶ Table 3.5, “Supported NVIDIA Quadro Plex Products” on page 21
- ▶ Table 3.6, “Supported NVIDIA Quadro Blade/Embedded Graphics Board Series” on page 21
- ▶ Table 3.7, “Supported NVIDIA Tesla Products” on page 22

NVIDIA Quadro & NVS Product

Table 3.1 Supported NVIDIA Quadro & NVS Products

Product	Notes
NVIDIA Quadro 6000	
NVIDIA Quadro 5000	
NVIDIA Quadro 4000	
NVIDIA Quadro 2000D	
NVIDIA Quadro 2000	
NVIDIA Quadro 600	
NVIDIA Quadro 410	
NVIDIA Quadro 400	
NVIDIA Quadro FX 5800	
NVIDIA Quadro FX 5600	
NVIDIA Quadro FX 5500	
NVIDIA Quadro FX 4800	
NVIDIA Quadro FX 4700 X2	
NVIDIA Quadro FX 4600	
NVIDIA Quadro FX 4500 X2	
NVIDIA Quadro FX 4500	
NVIDIA Quadro FX 4400	
NVIDIA Quadro FX 4400G	
NVIDIA Quadro FX 4000	
NVIDIA Quadro FX 3800	
NVIDIA Quadro FX 3700	

Table 3.1 Supported NVIDIA Quadro & NVS Products (continued)

Product	Notes
NVIDIA Quadro FX 3500	
NVIDIA Quadro FX 3450	
NVIDIA Quadro FX 3400	
NVIDIA Quadro FX 1800	
NVIDIA Quadro FX 1700	
NVIDIA Quadro FX 1500	
NVIDIA Quadro FX 1400	
NVIDIA Quadro FX 580	
NVIDIA Quadro FX 570	
NVIDIA Quadro FX 560	
NVIDIA Quadro FX 550	
NVIDIA Quadro FX 540	
NVIDIA Quadro FX 470	
NVIDIA Quadro FX 380	
NVIDIA Quadro FX 380 LP (low profile)	
NVIDIA Quadro FX 370	
NVIDIA Quadro FX 370 low profile	
NVIDIA Quadro FX 350	
NVIDIA Quadro VX 200	
NVIDIA Quadro CX	
NVIDIA NVS 310	
NVIDIA NVS 300	
NVIDIA Quadro NVS 450	
NVIDIA Quadro NVS 440	
NVIDIA Quadro NVS 420	
NVIDIA Quadro NVS 295	
NVIDIA Quadro NVS 290	
NVIDIA Quadro NVS 285	

NVIDIA Quadro G-Sync Products

Table 3.2 Supported NVIDIA Quadro G-Sync Products

Product	Notes
NVIDIA Quadro FX 5500	
NVIDIA Quadro FX 4500 X2	
NVIDIA Quadro FX 4500	

NVIDIA Quadro G-Sync II Products

Table 3.3 Supported NVIDIA Quadro G-Sync II Products

Product	Notes
NVIDIA Quadro 6000	
NVIDIA Quadro 5000	
NVIDIA Quadro FX 5800	
NVIDIA Quadro FX 4800	
NVIDIA Quadro FX 5600	
NVIDIA Quadro FX 4600	

NVIDIA Quadro SDI Products

Table 3.4 Supported NVIDIA Quadro SDI Products

Product	Notes
NVIDIA Quadro 6000 SDI	
NVIDIA Quadro 5000 SDI	
NVIDIA Quadro 4000 SDI	
NVIDIA Quadro FX 5800 SDI	
NVIDIA Quadro CX SDI	
NVIDIA Quadro FX 5600 SDI	
NVIDIA Quadro FX 4800 SDI	
NVIDIA Quadro FX 4600 SDI	
NVIDIA Quadro FX 3800 SDI	

NVIDIA Quadro Plex Products

Table 3.5 Supported NVIDIA Quadro Plex Products

Product	Notes
NVIDIA Quadro Plex 7000	
NVIDIA Quadro Plex D Series	
NVIDIA Quadro Plex S Series	
NVIDIA Quadro Plex Model II	
NVIDIA Quadro Plex Model IV	

NVIDIA Quadro Blade/Embedded Graphics Board

Table 3.6 Supported NVIDIA Quadro Blade/Embedded Graphics Board Series

Product	Notes
NVIDIA Quadro FX 3600M	
NVIDIA Quadro FX 2800M	
NVIDIA Quadro FX 1600M	
NVIDIA Quadro FX 880M	
NVIDIA Quadro FX 770M	
NVIDIA Quadro FX 560M	
NVIDIA Quadro FX 370M	
NVIDIA Quadro NVS 120M	

NVIDIA Tesla Products

The Tesla driver package is designed for systems that have one or more Tesla products installed.

- ▶ Only one GHIC can be connected to the server in a Tesla system.
- ▶ This release of the Tesla driver supports CUDA C/C++ applications and libraries that rely on the CUDA C Runtime and/or CUDA Driver API.

Table 3.7 Supported NVIDIA Tesla Products

Product	Notes
Tesla S-Class Products	
NVIDIA Tesla S2050	
NVIDIA Tesla S1070	
Tesla M-Class Products	
NVIDIA Tesla M2090	
NVIDIA Tesla M2075	
NVIDIA Tesla M2070	
NVIDIA Tesla M2070Q	
NVIDIA Tesla M2050	
NVIDIA Tesla M1060	
Tesla C-Class Products	
NVIDIA Tesla C2075	
NVIDIA Tesla C2070	
NVIDIA Tesla C2050	
NVIDIA Tesla C1060	

Supported Languages

The Release 295 Graphics Drivers supports the following languages in the main driver Control Panel:

English (USA)	German	Portuguese (Euro/ Iberian)
English (UK)	Greek	Russian
Arabic	Hebrew	Slovak
Chinese (Simplified)	Hungarian	Slovenian
Chinese (Traditional)	Italian	Spanish
Czech	Japanese	Spanish (Latin America)
Danish	Korean	Swedish
Dutch	Norwegian	Thai
Finnish	Polish	Turkish
French	Portuguese (Brazil)	

Driver Installation

Minimum Hard Disk Space

The hard disk space requirement for 32-bit is minimum 180 MB for English-only, and 270 MB for International.

The hard disk space requirement for 64-bit is minimum 250 MB for English-only, and 350 MB for International.

Before You Begin

nTune

If you have previously installed NVIDIA nTune, NVIDIA recommends that you uninstall nTune before installing this driver. After the driver install is complete, you can reinstall NVIDIA nTune.

SLI Mosaic Mode

You must make sure SLI Mosaic mode is disabled before installing a new driver over a previously installed driver. If SLI Mosaic mode is active on your displays when you install the new driver, the driver will not install properly.

Installation Instructions

- 1 Follow the instructions on the NVIDIA .com Web site driver download page to locate the appropriate driver to download, based on your hardware and operating system.
- 2 Click the driver download link.
The license agreement dialog box appears.
- 3 Click **Accept** if you accept the terms of the agreement, then either open the file or save the file to your PC and open it later.
- 4 Open the NVIDIA driver installation .EXE file to launch the NVIDIA InstallShield Wizard.
- 5 Follow the instructions in the NVIDIA InstallShield Wizard to complete the installation.



Note: If you are overinstalling the driver (installing over a previous driver without first removing the previous driver), then you must reboot your computer in order to complete the installation.

APPENDIX A MODE SUPPORT FOR WINDOWS

This chapter details the Windows modes supported by the Release 295 driver for NVIDIA products. It contains these sections:

- ▶ “General Mode Support Information” on page 26
- ▶ “Default Modes Supported by GPU” on page 27
- ▶ “Modes Supported by TV Encoders” on page 30

General Mode Support Information

The NVIDIA graphics driver includes a standard list of display modes that are supported by default. These modes are listed in the section “[Default Modes Supported by GPU](#)” on page 27.

The actual modes available depend on the capabilities of the display. In addition, the NVIDIA graphics driver has a “dynamic EDID detection” capability and will make available *additional* modes that are listed in the display EDID, provided the graphics hardware can support it.

The NVIDIA graphics driver also supports the high resolutions available with the displays listed in [Table A.1](#) as well as the non-standard modes listed in [Table A.2](#).

Table A.1 Modes Supported for High Resolution Displays

Display	Maximum Resolution
Apple 30" Cinema HD Display (Dual link DVI)	2560x1600 @ 60 Hz
Dell WFP 3007 (Dual Link DVI)	2560x1600 @ 60 Hz
HP LP3065 dual-link DVI flat panel	2560x1600 @ 60Hz.

Table A.2 Non-standard Modes Supported

Resolution		
1680 x 1050		
1366 x 768		

Default Modes Supported by GPU

This section lists the modes that are included by default in the driver INF for the following product families:

- ▶ “Tesla, Quadro, & NVS GPUs” on page 28
- ▶ “Modes Supported by TV Encoders” on page 30

Understanding the Mode Format

Figure A.1 gives an example of how to read the mode information presented in this section.

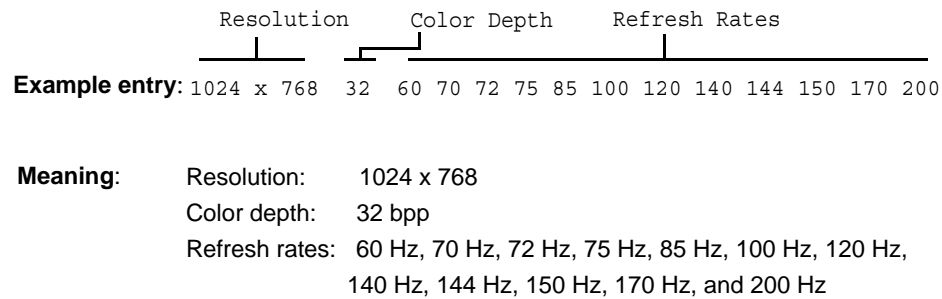


Figure A.1 Mode Format

Note:

- Horizontal spanning modes of 3840x1080 and above, and vertical spanning modes of 1920x2160 and above generally require at least 32 MB of video memory at 32 bpp.
- An “i” next to the refresh rate indicates an interlaced refresh rate.

Tesla, Quadro, & NVS GPUs

This sections lists the supported display resolutions, color depths, and refresh rates for the products listed in [“Supported NVIDIA Products”](#) on page 18.

Standard Modes

640 x 480	8	60 70 72 75 85 100 120 140 144 150 170 200 240
720 x 480	8	60
720 x 576	8	50
800 x 600	8	60 70 72 75 85 100 120 140 144 150 170 200 240
1024 x 768	8	60 70 72 75 85 100 120 140 144 150 170 200 240
1152 x 864	8	60 70 72 75 85 100 120 140 144 150 170 200
1280 x 720	8	60
1280 x 768	8	60 70 72 75 85 100 120 140 144 150 170
1280 x 800	8	60 70 72 75 85 100 120 140 144 150 170
1280 x 960	8	60 70 72 75 85 100 120 140 144 150 170
1280 x 1024	8	60 70 72 75 85 100 120 140 144 150 170
1360 x 768	8	60 70 72 75 85 100 120 140 144 150 170
1600 x 900	8	60 70 72 75 85 100 120 140 144 150
1600 x 1024	8	60 70 72 75 85 100 120
1600 x 1200	8	60 70 72 75 85 100 120
1680 x 1050	8	60
1920 x 1080	8	60
1920 x 1200	8	60 70 72 75 85 100
1920 x 1440	8	60 70 72 75 85
2048 x 1536	8	60

640 x 480	16	60 70 72 75 85 100 120 140 144 150 170 200 240
720 x 480	16	60
720 x 576	16	50
800 x 600	16	60 70 72 75 85 100 120 140 144 150 170 200 240
1024 x 768	16	60 70 72 75 85 100 120 140 144 150 170 200 240
1152 x 864	16	60 70 72 75 85 100 120 140 144 150 170 200
1280 x 720	16	60
1280 x 768	16	60 70 72 75 85 100 120 140 144 150 170
1280 x 800	16	60 70 72 75 85 100 120 140 144 150 170
1280 x 960	16	60 70 72 75 85 100 120 140 144 150 170
1280 x 1024	16	60 70 72 75 85 100 120 140 144 150 170
1360 x 768	16	60 70 72 75 85 100 120 140 144 150 170
1600 x 900	16	60 70 72 75 85 100 120 140 144 150
1600 x 1024	16	60 70 72 75 85 100 120
1600 x 1200	16	60 70 72 75 85 100 120
1680 x 1050	16	60
1920 x 1080	16	60
1920 x 1200	16	60 70 72 75 85 100

1920 x 1440	16	60 70 72 75 85
2048 x 1536	16	60

640 x 480	32	60 70 72 75 85 100 120 140 144 150 170 200 240
720 x 480	32	60
720 x 576	32	50
800 x 600	32	60 70 72 75 85 100 120 140 144 150 170 200 240
1024 x 768	32	60 70 72 75 85 100 120 140 144 150 170 200 240
1152 x 864	32	60 70 72 75 85 100 120 140 144 150 170 200
1280 x 720	32	60
1280 x 768	32	60 70 72 75 85 100 120 140 144 150 170
1280 x 800	32	60 70 72 75 85 100 120 140 144 150 170
1280 x 960	32	60 70 72 75 85 100 120 140 144 150 170
1280 x 1024	32	60 70 72 75 85 100 120 140 144 150 170
1360 x 768	32	60 70 72 75 85 100 120 140 144 150 170
1600 x 900	32	60 70 72 75 85 100 120 140 144 150
1600 x 1024	32	60 70 72 75 85 100 120
1600 x 1200	32	60 70 72 75 85 100 120
1680 x 1050	32	60
1920 x 1080	32	60
1920 x 1200	32	60 70 72 75 85 100
1920 x 1440	32	60 70 72 75 85
2048 x 1536	32	60

Modes Supported by TV Encoders

Table A.3 and Table A.4 list the NTSC, PAL, and HDTV TV-Out modes supported by the NVIDIA driver.

Table A.3 Mode Support for S-Video and Composite Out

Resolution	Bit depth	Comments
320x200	8, 16, 32	DirectDraw mode; not selectable as a Windows desktop
320x240	8, 16, 32	DirectDraw mode; not selectable as a Windows desktop
640x400	8, 16, 32	DirectDraw mode; not selectable as a Windows desktop
640x480	8, 16, 32	
720x480	8, 16, 32	Overscans (for video)
720x576	8, 16, 32	Overscans (for video)
800x600	8, 16, 32	
1024x768	8, 16, 32	Conexant 25871 only

Table A.4 Mode Support for Component YPrPb Out and DVI Out

Resolution	Comments
480i (SDTV)	Supported on graphics boards with Conexant 875 or Philips 7108 TV encoders and compatible connectors, and compatible GeForce 8 Series and later GPUs.
480p (EDTV)	
720p (HDTV)	
1080i (HDTV)	
576i (PAL)	
576p (PAL)	

The driver supports manual overscan correction for component and DVI outputs. See the online NVIDIA Control Panel Help for instructions on how to use the overscan correction features.

APPENDIX B NVIDIA TESLA COMPUTE CLUSTER MODE

This chapter describes the Tesla Compute Cluster (TCC) mode.

- ▶ “About Tesla Compute Cluster Mode” on page 31
- ▶ “Operating on Systems with non-TCC NVIDIA GPUs” on page 33
- ▶ “Setting TCC Mode for Tesla Products” on page 33

About Tesla Compute Cluster Mode

TCC Overview

Tesla Compute Cluster (TCC) mode is designed for compute cluster nodes that have one or more Tesla products installed.

Benefits

- ▶ TCC drivers make it possible to use NVIDIA GPUs in nodes with non-NVIDIA integrated graphics.
- ▶ NVIDIA GPUs on systems running the TCC drivers will be available via Remote Desktop, both directly and via cluster management systems that rely on Remote Desktop.
- ▶ NVIDIA GPUs will be available to applications running as a Windows service (i.e. in Session 0) on systems running the Tesla driver in TCC mode.

TCC Does not Support Graphics Acceleration

- ▶ TCC mode does not provide CUDA–DirectX/OpenGL interoperability. It is a “non-display” driver, and NVIDIA GPUs using this driver will not support DirectX or OpenGL hardware acceleration.

Running CUDA Applications

- ▶ This release of the Tesla driver supports CUDA C/C++ applications and libraries that rely on the CUDA C Runtime and/or CUDA Driver API.
- ▶ NVIDIA GPUs running the Tesla driver in TCC mode will be available for CUDA applications running via services or Remote Desktop.
- ▶ In this release, all GPUs will be in compute exclusive mode. As a result, only one CUDA context may exist on a particular device at a time.
- ▶ SDK applications that use graphics will not run properly under TCC mode. The following are examples of CUDA SDK applications that are not supported:

bicubicTexture	boxFilter	cudaDecodeD3D9	smokeParticles
cudaDecodeGL	fluidsD3D9	fluidsGL	SobelFilter
imageDenoising	Mandelbrot	marchingCubes	volumeRender
nbody	oceanFFT	particles	
postProcessGL	recursiveGaussian	simpleD3D10	
simpleD3D10Texture	simpleD3D11Texture	simpleD3D9	
simpleD3D9Texture	simpleGL	simpleTexture3D	

Operating on Systems with non-TCC NVIDIA GPUs

- ▶ NVIDIA GPUs running under TCC mode may coexist with other display devices.
- ▶ The Tesla driver is overinstalled over any NVIDIA display driver in the system—the NVIDIA Tesla driver then becomes the only driver for all NVIDIA GPUs in the system.

If the Tesla driver is uninstalled at a later time, the previous driver is not restored.

- ▶ NVIDIA GPUs that do not support TCC mode will appear as “VGA adapters” in the Windows Device Manager and can be used to drive displays.

Non-supported NVIDIA GPUs can still function as CUDA devices, but the GPU’s graphics functionality is not available to applications.

Setting TCC Mode for Tesla Products

The following table shows the default TCC/non-TCC mode for supported Tesla products.

Table B.1 Default TCC Mode for Tesla Products

Tesla Product	Default Mode	Notes
C1060	TCC	
C2075	TCC non-TCC	Windows 7, Windows Server 2008 & Windows Server 2008 R2 Windows Vista
C2050	TCC non-TCC	Windows Server 2008 & Windows Server 2008 R2 Windows Vista, Windows 7
C2070	TCC non-TCC	Windows Server 2008 & Windows Server 2008 R2 Windows Vista, Windows 7
S2050	TCC	
S1070	TCC	
M1060	TCC	
M2050	TCC	
M2070	TCC	
M2075	TCC	
M2070-Q	non-TCC	
M2090	TCC	

To change the TCC mode, use the NVIDIA **smi** utility as follows:

```
nvidia-smi -g (GPU ID) -dm (0 for WDDM, 1 for TCC)
```


Notice

ALL NVIDIA DESIGN SPECIFICATIONS, REFERENCE BOARDS, FILES, DRAWINGS, DIAGNOSTICS, LISTS, AND OTHER DOCUMENTS (TOGETHER AND SEPARATELY, "MATERIALS") ARE BEING PROVIDED "AS IS." NVIDIA MAKES NO WARRANTIES, EXPRESSED, IMPLIED, STATUTORY, OR OTHERWISE WITH RESPECT TO THE MATERIALS, AND EXPRESSLY DISCLAIMS ALL IMPLIED WARRANTIES OF NONINFRINGEMENT, MERCHANTABILITY, AND FITNESS FOR A PARTICULAR PURPOSE.

Information furnished is believed to be accurate and reliable. However, NVIDIA Corporation assumes no responsibility for the consequences of use of such information or for any infringement of patents or other rights of third parties that may result from its use. No license is granted by implication of otherwise under any patent rights of NVIDIA Corporation. Specifications mentioned in this publication are subject to change without notice. This publication supersedes and replaces all other information previously supplied. NVIDIA Corporation products are not authorized as critical components in life support devices or systems without express written approval of NVIDIA Corporation.

HDMI

HDMI, the HDMI logo, and High-Definition Multimedia Interface are trademarks or registered trademarks of HDMI Licensing LLC.

Macrovision Compliance Statement

NVIDIA Products that are Macrovision enabled can only be sold or distributed to buyers with a valid and existing authorization from Macrovision to purchase and incorporate the device into buyer's products.

Macrovision copy protection technology is protected by U.S. patent numbers 5,583,936; 6,516,132; 6,836,549; and 7,050,698 and other intellectual property rights. The use of Macrovision's copy protection technology in the device must be authorized by Macrovision and is intended for home and other limited pay-per-view uses only, unless otherwise authorized in writing by Macrovision. Reverse engineering or disassembly is prohibited.

OpenCL Notice

Portions of the NVIDIA system software contain components licensed from third parties under the following terms:

Clang & LLVM:

Copyright (c) 2003-2008 University of Illinois at Urbana-Champaign.

All rights reserved.

Portions of LLVM's System library:

Copyright (C) 2004 eXtensible Systems, Inc.

Developed by:

LLVM Team

University of Illinois at Urbana-Champaign

<http://llvm.org>

Permission is hereby granted, free of charge, to any person obtaining a copy of this software and associated documentation files (the "Software"), to deal with the Software without restriction, including without limitation the rights to use, copy, modify, merge, publish, distribute, sublicense, and/or sell copies of the Software, and to permit persons to whom the Software is furnished to do so, subject to the following conditions:

Redistributions of source code must retain the above copyright notice, this list of conditions and the following disclaimers.

Redistributions in binary form must reproduce the above copyright notice, this list of conditions and the following disclaimers in the documentation and/or other materials provided with the distribution.

Neither the names of the LLVM Team, University of Illinois at Urbana-Champaign, nor the names of its contributors may be used to endorse or promote products derived from this Software without specific prior written permission.

THE SOFTWARE IS PROVIDED "AS IS", WITHOUT WARRANTY OF ANY KIND, EXPRESS OR IMPLIED, INCLUDING BUT NOT LIMITED TO THE WARRANTIES OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE AND NONINFRINGEMENT. IN NO EVENT SHALL THE CONTRIBUTORS OR COPYRIGHT HOLDERS BE LIABLE FOR ANY CLAIM, DAMAGES OR OTHER LIABILITY, WHETHER IN AN ACTION OF CONTRACT, TORT OR OTHERWISE, ARISING FROM, OUT OF OR IN CONNECTION WITH THE SOFTWARE OR THE USE OR OTHER DEALINGS WITH THE SOFTWARE.

Trademarks

NVIDIA, the NVIDIA logo, NVIDIA nForce, GeForce, NVIDIA Quadro, NVDDVD, NVIDIA Personal Cinema, NVIDIA Soundstorm, Vanta, TNT2, TNT, RIVA, RIVA TNT, VODOO, VODOO GRAPHICS, WAVEBAY, Accuview Antialiasing, Detonator, Digital Vibrance Control, ForceWare, NVRotate, NVSensor, NVSync, PowerMizer, Quincunx Antialiasing, Sceneshare, See What You've Been Missing, StreamThru, SuperStability, T-BUFFER, The Way It's Meant to be Played Logo, TwinBank, TwinView and the Video & Nth Superscript Design Logo are registered trademarks or trademarks of NVIDIA Corporation in the United States and/or other countries. Other company and product names may be trademarks or registered trademarks of the respective owners with which they are associated.

Copyright

© 2009, 2012 NVIDIA Corporation. All rights reserved.