



NVIDIA Quadro Professional Drivers ***Release 95 Notes***

Version 97.84

**For Windows XP and
Windows XP Professional x64 Edition**

2nd Edition

**NVIDIA Corporation
June 2007**

Published by
NVIDIA Corporation
2701 San Tomas Expressway
Santa Clara, CA 95050

Notice

ALL NVIDIA DESIGN SPECIFICATIONS, REFERENCE BOARDS, FILES, DRAWINGS, DIAGNOSTICS, LISTS, AND OTHER DOCUMENTS (TOGETHER AND SEPARATELY, "MATERIALS") ARE BEING PROVIDED "AS IS." NVIDIA MAKES NO WARRANTIES, EXPRESSED, IMPLIED, STATUTORY, OR OTHERWISE WITH RESPECT TO THE MATERIALS, AND EXPRESSLY DISCLAIMS ALL IMPLIED WARRANTIES OF NONINFRINGEMENT, MERCHANTABILITY, AND FITNESS FOR A PARTICULAR PURPOSE.

Information furnished is believed to be accurate and reliable. However, NVIDIA Corporation assumes no responsibility for the consequences of use of such information or for any infringement of patents or other rights of third parties that may result from its use. No license is granted by implication or otherwise under any patent or patent rights of NVIDIA Corporation. Specifications mentioned in this publication are subject to change without notice. This publication supersedes and replaces all information previously supplied. NVIDIA Corporation products are not authorized for use as critical components in life support devices or systems without express written approval of NVIDIA Corporation.

Trademarks

NVIDIA, the NVIDIA logo, NVIDIA nForce, GeForce, NVIDIA Quadro, NVIDIA Quadro G-Sync, and NVIDIA SLI are registered trademarks or trademarks of NVIDIA Corporation in the United States and/or other countries.

Other company and product names may be trademarks or registered trademarks of the respective owners with which they are associated.

Copyright

© 2006, 2007 NVIDIA Corporation. All rights reserved.



Table of Contents



1. Introduction to <i>Release 95 Notes</i>	
Structure of the Document	1
Changes in this Edition	1
2. Release 95 Driver Issues	
Issues Resolved in version 97.84	3
Issues Resolved in Version 96.03	3
Issues Resolved in Version 95.97	3
Special Instructional Notes for this Release	4
Enabling 3D Stereo with Multiple Displays	4
Turning Off V-Sync to Boost Performance	4
Open Issues in Version 97.84	5
NVIDIA Recommendations	5
NVIDIA Issues—Single GPU	6
NVIDIA Issues—SLI Mode	7
Known Product Limitations	8
SLI Connector Requirement on NVIDIA Quadro SLI Cards	8
DirectX Fails When Detaching/Reattaching Displays in Dualview Mode	9
OpenGL Viewport Scaling Problem in Horizontal Span Mode	9
Video Playback in nView Clone and Span Modes	9
Applying Workstation Application Profiles	10
Hide Modes Check Box Cannot be Cleared	10
Windows XP/2000 Issue with Settings Tab Monitor Positioning	11
Gigabyte GA-6BX Motherboard	11
Windows Media Player Hangs Playing MPEG Files	12
Antialiasing Problems With Certain Applications 12	
Poor Quality S-Video Output on Some TVs	12
Desktop Manager Does Not Re-Center Logon Screen	13
Issues with Video Mirror—Windows XP/2000	13
4. The Release 95 Driver	
Hardware and Software Support	15
Supported Operating Systems	15
Supported NVIDIA Products	16
Supported Languages	16
Driver Installation	17
System Requirements	17
Installation Instructions	18
5. NVIDIA Driver History	
Driver Release History	22
Release 95 Enhancements	23
Product Support	23
OpenGL	23
Release 90 Enhancements	23
OpenGL	24
Video	24
Control Panel	24
Release 80 Enhancements	25
Additional Details by Driver Module	26
A. Mode Support for Windows	
General Mode Support Information	28
Default Modes Supported by GPU	29
Understanding the Mode Format	29
NVIDIA Quadro FX Family of High End GPUs	30
30	
Modes Supported by DACs and TV Encoders	36
External DAC Mode Support	36
TV-Out Mode Support	37



List of Tables



Table 3.1	Known Issues with Video Mirror	13
Table 4.1	Supported NVIDIA G-Sync II Products	16
Table 4.2	Supported NVIDIA Quadro Plex Products	16
Table 4.3	Hard Disk Space Requirements—English	17
Table 4.4	Hard Disk Space Requirements—Non-English Languages	17
Table 4.5	Hard Disk Space Requirements—Full International Package	17
Table 5.1	NVIDIA Drivers for Windows	22
Table A.1	Modes Supported for High Resolution Displays	28
Table A.2	Non-standard Modes Supported	28
Table A.3	External DAC Modes (Fairchild FMS3815).	36
Table A.4	External DAC Modes (Analog Devices ADV-7123).	36
Table A.5	Mode Support for S-Video and Composite Out	37
Table A.6	Mode Support for Component YPrPb Out and DVI Out	37

CHAPTER

1

INTRODUCTION TO *RELEASE 95 NOTES*

This edition of *Release 95 Notes* describes NVIDIA® Release 95 drivers for NVIDIA GPUs running Microsoft® Windows® and provides information that is applicable to all NVIDIA drivers. NVIDIA provides these notes to describe performance improvements and bug fixes in each documented version of the driver.

Structure of the Document

This document is organized in the following sections:

- “[Release 95 Driver Issues](#)” on page 2 gives a summary of
 - Issues that have been resolved in this version
 - Issues that are open in this version
 - Known limitations of the driver
- “[The Release 95 Driver](#)” on page 15 describes the NVIDIA products and languages supported by this driver, the system requirements, and how to install the driver.
- “[NVIDIA Driver History](#)” on page 21 describes the new features included in the Release 95 driver (see “[Release 95 Enhancements](#)” on page 23) as well as information on previous driver releases.
- “[Mode Support for Windows](#)” on page 27

Changes in this Edition

This edition of *Release 95 Notes* is an update to the previous 97.84 edition released in April 2007, and adds NVIDIA G-Sync II products (NVIDIA Quadro FX 5600 and NVIDIA Quadro FX 4600) to the list of supported products. It discusses changes made to the driver since version 95.97. These changes are discussed beginning with the chapter “[Release 95 Driver Issues](#)” on page 2.

CHAPTER

2

RELEASE 95 DRIVER ISSUES

This chapter describes open issues for version 97.84, and resolved issues and driver enhancements for versions of the Release 95 driver up to version 97.84. The chapter contains these sections:

- “Issues Resolved in version 97.84” on page 3
- “Issues Resolved in Version 96.03” on page 3
- “Issues Resolved in Version 95.97” on page 3
- “Special Instructional Notes for this Release” on page 4
- “Known Product Limitations” on page 8

Issues Resolved in version 97.84

The following are changes made and issues resolved in driver version 97.84

- Added support for the NVIDIA Quadro Plex 1000 Model IV.
- Added support in the NVIDIA Control Panel for dual Quadro Plex units.

Issues Resolved in Version 96.03

The following are changes made and issues resolved in driver version 96.03

- OpenGL applications do not shut down when dual core machines shut down or restart.
- There is no preview of customized timings when they are created in the NVIDIA Control Panel->Manage Custom Timings page.
- The preview image is missing in the NVIDIA Control Panel-> Adjust Desktop Color Settings page.
- Ghosting images appear in NVSG animations when SLI AA is enabled.

Issues Resolved in Version 95.97

The following are changes made and issues resolved in driver version 95.97.

- NVIDIA Control Panel: Synchronize Displays link is not available when primary display is not connected to G-Sync card.
- NVIDIA Control Panel, 2 × Quadro FX 4500: Unable to return to Landscape mode after a Rotate.
- NVIDIA Control Panel: Unable to turn on SDI in Dualview mode from nView display page.

Special Instructional Notes for this Release

This section clarifies instructions for successfully accomplishing the following tasks:

Enabling 3D Stereo with Multiple Displays

To make sure that you successfully enable 3D stereo in a multi-display configuration, you must first enable stereo in single-display mode and then close the NVIDIA Control Panel before setting up multi-display modes. Otherwise, you will lose your stereo settings.

1 Enable 3D stereo

- 1 Open the NVIDIA Control Panel, then set single-display mode using the Set Up Display Configuration page.
- 2 Set stereo settings using the Manage 3D Settings page.
- 3 Close the NVIDIA Control Panel.

2 Enable multiple displays

Using either the Windows Display Properties page or by re-opening the NVIDIA Control panel->Set up Display Configuration page, set the desired multi-display mode.

- 3 Set up other NVIDIA Control Panel->Workstation settings as needed, such as frame locking.

Turning Off V-Sync to Boost Performance

To get the best benchmark and application performance measurements, turn V-Sync off as follows:

- 1 Open the NVIDIA Control Panel and enable Advanced View.
- 2 In the 3D Settings Category, click Manage 3D Settings.
- 3 From the Global presets pulldown menu, select **Custom** and then click **Apply**.
- 4 From the Settings listbox, select **Vertical sync** and change its value to **Force off**, then click **Apply**.
- 5 From the Global presets pulldown menu, select **3D App - Default Global Settings** (the driver's default profile) or use the application profile that matches the application you are testing, then click **Apply**.

Be sure to close the NVIDIA Control Panel completely —leaving it open will affect benchmark and application performance.

Open Issues in Version 97.84

As with every released driver, version 97.84 of the Release 95 driver has open issues and enhancement requests associated with it. This section includes lists of issues that are either not fixed or not implemented in this version. Some problems listed may not have been thoroughly investigated and, in fact, may not be NVIDIA issues. Others will have workaround solutions.

They are listed in the following sections:

- “NVIDIA Recommendations” on page 5
- “NVIDIA Issues—Single GPU” on page 6
- “NVIDIA Issues—SLI Mode” on page 7

NVIDIA Recommendations

- Single display modes such as TV only, DFP/LCD only or CRT only provide the best performance and quality from Windows Media Center Edition.

Dual display modes such Dualview and nView Clone and Span modes are not recommended.

- When using the trial version of WinDVD 6 from InterVideo.com, you may experience TV or DVD playback problems in Windows Media Center if you change resolutions during video playback. This is most often seen when switching from windowed to full screen mode.

This problem does not occur with the latest full OEM versions of WinDVD or with other Windows Media Center qualified DVD decoders.

- If you perform a clean driver installation (no previous NVIDIA drivers installed), **you must reboot your computer**. If you do not reboot, the predefined application profiles will not be activated and you may experience application stability problems. [124320]

NVIDIA Issues—Single GPU

This section includes issues that occur under the Windows XP or Windows 2000:

- Workstation, G-Sync: The GDI frequency instead of the actual display frequency is used as the sync frequency when a display is set to be the server using internal timing. [287682]
- Dual NVIDIA Quadro FX 4600: Changes made to the NVIDIA Control Panel Advanced 3D Image Settings do not take effect.[291951]
- NVIDIA Quadro FX 4600: Desktop Overlap feature is missing.[238583]
- There may be intermittent application compatibility issues with dual core CPUs.

If you experience this issue, you can work around it by toggling off multithread optimizations using the following instructions:

- 1 Launch **regedit** and determine the current primary display card by looking in

HKey_Local_Machine\Hardware\DeviceMap\Video

and note the GUID (global unique identifier assigned by Windows), which is the long string in brackets { } at the end of the entry

"\device\video0".

- 2 Look in

HKey_Local_Machine\SYSTEM\CurrentControlSet\Control\Video\{GUID}\0000

where {GUID} is the number derived from the previous step.

- 3 Open the "0000" directory and create a new DWORD called **OGL_ThreadControl** and give it a value of **2**.

This will disable multithreading in the driver for all OpenGL applications.

- 4 If you want to disable driver multithreading for all Direct3D applications—
In the same "0000" directory, create a new DWORD called **WTD_EXECCMODEL** and give it a value of **0**.

- Video color-space range for DVI-only¹ outputs is erroneously set to standard mode (16-235) instead of extended mode (0-255).

A new detection feature to apply Standard CSC mode to TV outputs (including NTSC, PAL, 480i, and 576i), included DVI-only outputs by mistake.

Note: *The driver correctly applies extended mode to analog outputs, and standard mode to TV outputs (including NTSC, PAL, 480i, and 576i).*

A future driver release will correct this and apply the extended-mode color space to DVI-only outputs.

You can work around this issue by forcing either standard or extended mode as follows:

- 1 Launch **regedit** and determine the current primary display card by looking in

`HKey_Local_Machine\Hardware\DeviceMap\Video`

and note the GUID (global unique identifier assigned by Windows), which is the long string in brackets { } at the end of the entry

`"\device\video0"`.

- 2 Look in

`HKey_Local_Machine\SYSTEM\CurrentControlSet\Control\Video\{GUID}\0000`

where {GUID} is the number derived from the previous step.

- 3 Open the "0000" directory and create a new DWORD called **VMRCCSStatus** and give it a value of

0x3 - to force use of the standard YUV range of 16-235

0x1 - to force use of the extended YUV range of 0-255

NVIDIA Issues—SLI Mode

This section includes SLI technology related issues that occur under the Windows XP, or Windows 2000 OS:

- [SLI], NVIDIA Quadro FX 4600: OpenGL applications crash after resuming from Standby or Hibernate mode.[282965]
- [SLI]: With SLI mode enabled, the NVIDIA Control Panel->Workstation->View Status page does not the correct monitor connections.[241808]

1. "DVI-only" means only one display is connected, and it is to the DVI output.

Known Product Limitations

This section describes problems that will not be fixed. Usually, the source of the problem is beyond the control of NVIDIA. Following is the list of problems and where they are discussed in this document:

- “SLI Connector Requirement on NVIDIA Quadro SLI Cards” on page 8
- “DirectX Fails When Detaching/Reattaching Displays in Dualview Mode” on page 9
- “OpenGL Viewport Scaling Problem in Horizontal Span Mode” on page 9
- “Video Playback in nView Clone and Span Modes” on page 9
- “Applying Workstation Application Profiles” on page 10
- “Hide Modes Check Box Cannot be Cleared” on page 10
- “Windows XP/2000 Issue with Settings Tab Monitor Positioning” on page 11
- “Gigabyte GA-6BX Motherboard” on page 11
- “Windows Media Player Hangs Playing MPEG Files” on page 12
- “Antialiasing Problems With Certain Applications” on page 12
- “Poor Quality S-Video Output on Some TVs” on page 12
- “Desktop Manager Does Not Re-Center Logon Screen” on page 13
- “Issues with Video Mirror–Windows XP/2000” on page 13

SLI Connector Requirement on NVIDIA Quadro SLI Cards

The SLI connector that links two SLI cards is needed for proper SLI operation. However, the connector can be removed if you do not intend to enable SLI mode. If you remove the connector, then you must make sure that SLI mode is disabled from the NVIDIA control panel. Enabling SLI mode without the SLI connector installed will result in video corruption.

DirectX Fails When Detaching/Reattaching Displays in Dualview Mode

This problem can be duplicated as follows:

- 1 Enable both displays in Dualview mode.
- 2 Detach monitor 2 and apply settings.
- 3 Reattach monitor 2 and apply settings.

DirectX runtime fails on monitor 1.

This is not an NVIDIA bug, but a limitation in the operating system where DirectX does not enumerate the second device. DirectX can be restored to both displays by rebooting the system

OpenGL Viewport Scaling Problem in Horizontal Span Mode

With nView Horizontal Span mode enabled, when opening an OpenGL model in a viewport, the model image is scaled too large to fit in the viewport. The problem occurs with such applications as Maya 5.0 and 3D Studio MAX 4.26.

This is not an NVIDIA bug, but a limitation in the application's ability to properly maintain the aspect ratio in Horizontal Span mode.

Video Playback in nView Clone and Span Modes

- **Problem**

With nView Clone or Span mode enabled, video playback appears on only one display under the following conditions:

- Under nView Clone mode, when full-screen video mirror is not used.
- Under nView Span mode, when full-screen video mirror is not used and the video is positioned to span across both monitors.

- **Explanation**

With applications that render using the hardware overlay—such as DirectX applications—the default driver behavior for Release 60 is to enable the hardware overlay when nView Clone or Span mode is enabled.

Because the driver supports only one hardware overlay, the video appears on only one display.

Applying Workstation Application Profiles

- **Background**

The workstation application profiles are software settings used by the NVIDIA Display Drivers to provide optimum performance when using a selected application. The profile also works around known application issues and bugs.

If there is an available setting for an application, it should be used, otherwise incorrect behavior or reduced performance is likely to occur.

- **Issues**

Configuration changes require the application to restart.

Running applications do not receive notification of configuration changes, Therefore, if you change the configuration while the application is running, you must exit and restart the application for the configuration changes to take effect.

Hide Modes Check Box Cannot be Cleared

- **Background**

One of the NVIDIA display property page dialog boxes contains the check box labelled "Hide modes that this monitor cannot display". It is checked by default, indicating that only the refresh rates supported by the monitor are listed in the refresh rate drop down list.

The check box appears in the Device Adjustments->Monitor Settings page.

- **Problem**

If you clear the check box, click **Apply**, and then close the dialog box, the check box is still checked when the page is re-opened.

- **Explanation**

This function is no longer controlled by the NVIDIA driver, but has not been removed from the control panel in order to maintain consistency with driver designs that are currently being shipped to OEMs.

Windows XP/2000 Issue with Settings Tab Monitor Positioning

- **Problem**

In the Windows **Display Properties** > **Settings** tab, the secondary monitors cannot be positioned directly above monitor #1 without snapping horizontally to a position diagonal to monitor #1.

- **When the Problem Occurs**

The problem occurs when four monitors are connected to the graphics adapter card, but only two of them are enabled.

- **Cause and Workaround**

This is a Microsoft—not an NVIDIA—bug, and there is no workaround to correct the positioning of the monitor icons. However, the actual positioning of the displays on the desktop can be corrected using the nView Desktop Manager window as follows:

- 1 Under the Tools tab in the Desktop Manager windows, make sure Automatically Align Displays is checked.
- 2 In the Settings tab, position the appropriate monitor icon above monitor #1, then click **Apply**.

The mouse cursor movement between monitor desktops will correspond to a vertical orientation of the monitors, even though the monitor icons in the Settings tab are diagonal to each other.

Note: This will be the case even if the monitor icons are deliberately positioned diagonal to each other.

Gigabyte GA-6BX Motherboard

This motherboard uses a Linfinity regulator on the 3.3-V rail that is rated to only 5 A—less than the AGP specification, which requires 6 A. When diagnostics or applications are running, the temperature of the regulator rises, causing the voltage to the NVIDIA chip to drop as low as 2.2 V. Under these circumstances, the regulator cannot supply the current on the 3.3-V rail that the NVIDIA chip requires.

This problem does not occur when the graphics board has a switching regulator or when an external power supply is connected to the 3.3-V rail.

Windows Media Player Hangs Playing MPEG Files

On systems using the InterVideo WinDVD player (including ones that don't contain NVIDIA components), Windows Media Player 6.4 halts if the slider is adjusted while an MPEG clip is playing. The problem also occurs if Active Movie or the Movie Player on the Windows 98 CD is used instead of Media Player 6.4.

There are two ways to work around this problem:

- Under **Display Properties > Settings > Advanced... > Performance**, set **Graphics Hardware acceleration** to **None**.
- Uninstall the WinDVD player.

This is not an NVIDIA bug.

Antialiasing Problems With Certain Applications

Antialiasing in the NVIDIA Direct3D driver requires each new frame to be rendered from scratch. This requirement adversely affects applications that render only that portion of the content that has changed since the last frame. A common symptom of this problem is geometric structures that incorrectly disappear and re-appear as the scene shifts.

Poor Quality S-Video Output on Some TVs

NVIDIA drivers differentiate an S-video TV from a composite TV by searching for 75-Ohm loads on the chrominance and luminance lines. If the driver detects only one such load, it assumes that it has a composite TV and drives both chroma and luma onto that line. This approach allows both types of TV to display in color.

Unfortunately, some S-video TVs do not apply the correct load to both lines, causing the driver to detect an S-video TV as a composite. The driver, in turn, sends the lower quality signal to the S-video TV. To work around this problem, use the Control Panel to override the **Auto-select** feature. This can be done following these steps:

- 1 In the **Settings** tab of the **Display Properties** Control Panel, click **Advanced**.
- 2 In the **nView** tab, click **Device Settings** and click **Select Output Device**.
- 3 In the **Device Selection** tab, click the **TV** option.
- 4 Change the **Video output format** to **S-video**.

Desktop Manager Does Not Re-Center Logon Screen

On Windows NT 4.0, Windows 2000, and Windows XP multi-display systems that are set to nView Span mode, the Windows logon screen is centered on the extended desktop. This usually causes it to be split across two displays, which users may find annoying. Although users can normally use the Desktop Manager to restrict a window's appearance to one display, security restrictions in the operating systems prevent this in the case of the logon screen.

Issues with Video Mirror—Windows XP/2000

Table 3.1 lists current known issues with NVIDIA Video Mirror functionality.

Table 3.1 Known Issues with Video Mirror

Video Mirror is not yet implemented for applications using Video Port Extensions (VPE).
If Video Mirror is enabled but a full-screen display does not appear, one of the following problems may have occurred:
Video Mirror can only function when overlay is being used. The video player may not be able to create an overlay if another application is using the overlay, or the desktop display resolution is too high. You can lower the desktop resolution, pixel depth, or refresh rate.
Video Mirror requires some extra memory to run. Try closing other DirectX or OpenGL applications that may be running.
You may need to close and restart your video application for Video Mirror enabling or disabling to take effect.
Some video players that cannot detect the presence of Video Mirror stop playing if they are minimized or completely obscured by another window. For example, Media Player can exhibit this problem.

CHAPTER

4

THE RELEASE 95 DRIVER

This chapter covers the following main topics:

- “Hardware and Software Support” on page 15
- “Driver Installation” on page 17

See the section “Release 95 Enhancements” on page 23 for a summary of Release 95 features and enhancements.

Hardware and Software Support

Supported Operating Systems

This Release 95 driver includes drivers designed for the following Microsoft® operating systems:

- Microsoft Windows® XP
 - Windows XP Professional
 - Windows XP Home Edition
 - Windows XP Professional x64 Edition
- Microsoft Windows Server 2003 x64¹
- Microsoft Windows 2000

1. SLI mode is not supported under Microsoft Windows Server 2003 x64.

Supported NVIDIA Products

Table 4.1 Table 4.2 lists the NVIDIA products supported by Version 97.84 of the Release 95 driver.

Table 4.1 Supported NVIDIA G-Sync II Products

Product	Windows XP 32-bit Windows 2000	Windows XP Professional x64
NVIDIA Quadro FX 5600	X	X
NVIDIA Quadro FX 4600	X	X

Table 4.2 Supported NVIDIA Quadro Plex Products

Product	Windows XP	Windows XP Professional x64
NVIDIA Quadro Plex 1000 Model I	X	X
NVIDIA Quadro Plex 1000 Model II	X	X
NVIDIA Quadro Plex 1000 Model III	X	X
NVIDIA Quadro Plex 1000 Model IV	X	X

Supported Languages

The Release 95 NVIDIA Quadro Professional Drivers supports the following languages in the main driver Control Panel:

English (USA)	German	Portuguese (Euro/Iberian)
English (UK)	Greek	Russian
Arabic	Hebrew	Slovak
Chinese (Simplified)	Hungarian	Slovenian
Chinese (Traditional)	Italian	Spanish
Czech	Japanese	Spanish (Latin America)
Danish	Korean	Swedish
Dutch	Norwegian	Thai
Finnish	Polish	Turkish
French	Portuguese (Brazil)	

Driver Installation

System Requirements

The minimum hard disk space requirement for each operating system are listed in [Table 4.3](#), [Table 4.4](#), and [Table 4.5](#):

Table 4.3 Hard Disk Space Requirements—English

Operating System	Minimum Hard Disk Space
Windows XP (all editions)	43.4 MB
Windows Server 2003 x64	42.2 MB

Table 4.4 Hard Disk Space Requirements—Non-English Languages

Operating System	Minimum Hard Disk Space
Windows XP (all editions)	26.6 MB
Windows Server 2003 x64	34.9 MB

Table 4.5 Hard Disk Space Requirements—Full International Package

Operating System	Minimum Hard Disk Space
Windows XP (all editions)	70.0 MB
Windows Server 2003 x64	77.1 MB

Installation Instructions

Before You Begin

- If you do not have System Administrator access privileges, it is assumed that the appropriate person with System Administrator access in your organization will set up and install the NVIDIA graphics driver software on your computer.
- The installation process copies all necessary files for operation into the appropriate directories.
- The nView system files are copied to your **Windows\System** directory.
- nView Desktop Manager Profile files (*.tvp) are saved in the **Windows\Nview** directory.

Depending on the version of the NVIDIA driver previously installed, profiles may also be located in the **Documents and Settings\All Users\Application Data\nView_Profiles** directory.

- As part of the install process, an uninstall is registered in your system.
- Under Windows XP, the NVIDIA driver is installed in “Dualview mode” display. However, note that the second display is not activated by default, but must be enabled.

Preserving Settings Before Upgrading Your Software

Before uninstalling or installing software, you can preserve your nView Desktop Manager and/or NVIDIA Display settings by using the nView Desktop Manager Profiles features.

Note: Follow the steps below and/or refer to the *NVIDIA nView Desktop Manager User's Guide* for details. Under Windows XP/2000 and Windows NT 4.0, you must have, at least, **Power User** access privileges in order to create or save a profile. (Refer to Windows Help if you need an explanation of Power User access rights.)

Follow the steps below and/or refer to the *NVIDIA nView Desktop Manager User's Guide* for details.

- 1 Open the nView Desktop Manager Profiles page.
- 2 To preserve your current settings, you can use either the **Save** or the **New** option from the nView Desktop Manager Profiles page:
 - If you want to overwrite the currently loaded profile with your changed settings, use the **Save** option. Notice that a warning message indicates that you are about to overwrite the selected profile.
 - If you want to retain the currently loaded profile and want to save your changed settings to a new file, click the **New** option. Enter a name and description of the profile in the New Profile dialog box. For example, you can name this profile **My Settings**.
- 3 If you are an "advanced" user and want to customize certain settings in the saved profile, click **Advanced** << to expand the dialog box .
- 4 To customize the settings, you can select or clear any of the settings check boxes.
- 5 Click **Save** to return to the main Profiles page.

If you created a new profile, you will see the name of the newly created profile in the profiles list.

If you overwrote a current profile, the same profile name is retained in the list.

Note: nView Desktop Manager profile (. **tnp**) files are saved in the **Windows\ nView** directory. Depending on the version of the NVIDIA driver previously installed, profiles may also be saved in the **Documents and Settings\All Users\Application Data\ nView_Profiles** directory.

- 6 Now you can uninstall your current driver for a driver upgrade.
- 7 After you restart your computer following an NVIDIA new driver install, you can easily load the saved profile from the Profiles page of nView Desktop Manager.

About Using Saved Profiles in Another Computer

You can easily use any saved profile (.tvp file in the `Windows\nView` directory) from one computer and use it in another computer, if you want. You'll need to copy it to the `Windows\nView` directory of a computer that has the NVIDIA ForceWare graphics display driver, etc. installed properly. Then this profile can be loaded from another computer from the nView Desktop Manager Profiles page just as it can from your original computer.

Uninstalling the NVIDIA Display Driver Software

Note: It is highly recommended that you follow the steps in this section to completely uninstall the NVIDIA Display Driver software before updating to a new version of the software.

To uninstall the nView software, follow these steps:

- 1 From the Windows taskbar, click **Start > Settings > Control Panel** to open the Control Panel window.
- 2 Double-click the **Add/Remove Programs** item.
- 3 Click the **NVIDIA Display Driver** item from the list.
- 4 Click **Change/Remove**.
- 5 Click **Yes** to continue.

A prompt appears asking whether you want to delete all of the saved nView profiles.

- If you click **Yes**, all of the nView software and all of your saved profiles will be deleted.
- If you click **No**, the nView software is removed, but the profile files are saved in the `Windows\nView` directory on your hard disk.

Your system now restarts.

Installing the NVIDIA ForceWare Graphics Drivers

- 1 Follow the instructions on the NVIDIA.com Web site driver download page to locate the appropriate driver to download, based on your hardware and operating system.
- 2 Click the driver download link.

The license agreement dialog box appears.

- 3 Click **Accept** if you accept the terms of the agreement, then either open the file or save the file to your PC and open it later.

Opening the EXE file launches the NVIDIA InstallShield Wizard.

- 4 Follow the instructions in the NVIDIA InstallShield Wizard to complete the installation.

CHAPTER

5

NVIDIA DRIVER HISTORY

This chapter provides the driver release history and summarizes the features and enhancements that have been introduced in each release. It contains these sections:

- “Driver Release History” on page 22
- “Release 95 Enhancements” on page 23
- “Release 90 Enhancements” on page 23
- “Release 80 Enhancements” on page 25

Driver Release History

Release 95 is the latest NVIDIA driver available. [Table 5.1](#) contains a summary of some previous driver releases and the versions associated with them. Some versions listed may not have been released outside of NVIDIA.

Table 5.1 NVIDIA Drivers for Windows

Driver	Name	Versions	Comments
Release 95	ForceWare	95.97, 96.02, 96.03, 97.78, 97.84	
Release 90	ForceWare	91.36	
Release 80	ForceWare	81.67, 84.26	
Release 75	ForceWare	77.37, 77.56	
Release 70	ForceWare	71.84, 71.89	
Release 65	ForceWare	66.77, 66.93, 67.02, 67.03, 67.66	
Release 60	ForceWare	61.76, 61.77	
Release 55	ForceWare	56.64, 56.72, 57.30	
Release 50	ForceWare	52.16, 53.04	
Release 40	Detonator FX	44.03–45.xx	
Release 40	Detonator 40	40.60–44.02	
Release 35	Detonator 35	35.60–37.80	
Release 25	Detonator 25	26.00–32.90	
Release 20	Detonator XP	21.83–23.xx	
Release 10	Detonator 3 v1x.xx	10.00–17.xx	

Release 95 Enhancements

Product Support

- Added support for NVIDIA Quadro Plex visual computing systems.

OpenGL

Note: OpenGL release notes are periodically posted on the NVIDIA developer Web site: http://developer.nvidia.com/object/nv_ogl2_support.html.

- OpenGL 2.1 and OpenGL Shading Language version 1.20 are now supported.
- OpenGL Shading Language shaders that use the "#version 110" or "#version 120" directive now strictly adhere to the OpenGL Shading Language specification.

As a consequence, existing OpenGL Shading Language shaders that use the "#version 110" directive may fail to compile if they use language constructs that are invalid according to the OpenGL Shading Language specification. *This is true even if the shaders did compile using earlier NVIDIA driver releases.* Existing OpenGL Shading Language shaders that do not use the "#version 110" directive are not affected.

- The following extensions have been added:
 - GL_EXT_framebuffer_blit
 - GL_EXT_framebuffer_multisample
 - GL_NV_framebuffer_multisample_coverage
 - WGL_NV_gpu_affinity (NVIDIA Quadro only)

All of the NVIDIA OpenGL extensions can be found on the NVIDIA developer Web site:

http://developer.nvidia.com/object/nvidia_opengl_specs.html.

Release 90 Enhancements

Release 90 provides these new features and improvements:

- Establishes the new NVIDIA Control Panel as the recommended user interface.
- Includes several PureVideo improvements.
- Increased stability and performance.

OpenGL

The following extensions have been added:

- `WGL_NV_gpu_affinity`

Video

Release 90 includes the following new PureVideo features and improvements:

Video Processing Improvements

Release 90 includes several PureVideo technology improvements¹:

- Added noise reduction post processing
- Added image sharpening post processing
- Improved inverse telecine algorithm
- Improved de-interlacing algorithm
- Improved compatibility with third party MPEG-2 decoders

New Features—Available Only in the New NVIDIA Control Panel

- Color Temperature Correction
 - Allows users to compensate for monitor gamut differences
 - Enhances color correctness of video
- Video Gamma Enhancement to include RGB gamma adjustment
 - RGB Gamma for VMR9
 - Allows users to tweak gamma in channels separately
 - For both Overlay and VMR9

Control Panel

Release 90 introduces the new NVIDIA Control Panel as the recommended interface. The new interface provides intuitive navigation of NVIDIA display property controls, and will be the interface for other NVIDIA software.

1. Video processing improvements are seen in higher HQV benchmark scores.

While the Classic Control panel is still available, no changes or new features will appear in that interface.

Release 80 Enhancements

NVIDIA SLI™ Enhancements

- Dynamic Enable/Disable Capability
System reboot is no longer required after enabling or disabling SLI from the control panel.
- Cross-card compatibility
SLI no longer requires that graphics cards be identical, but they must still have the same core GPU.
- SLI performance without an SLI (bridge) connector on select graphics cards for the mainstream market
- Improved SLI performance and a streamlined list of application profiles for OpenGL
- Changing application profiles never requires a system reboot.
- TV/HDTV support under SLI
- Ability to select which display to use for the output.
- Additional SLI Support
Release 80 adds support for the following combinations of PCI Express graphics cards & chipsets:

Chipset	PCI-Express Graphics Cards
NVIDIA nForce4 SLI	
NVIDIA nForce4 SLI—Intel Edition	GeForce 7800 GT + GeForce 7800 GT GeForce 6800 XT + GeForce 6800 XT
NVIDIA nForce Professional 2200	GeForce 6800 XE + GeForce 6800 XE
NVIDIA nForce Professional 2200+ NVIDIA nForce Professional 2050	

NVIDIA PureVideo™ Enhancements

- Improved inverse 3:2 and 2:2 pulldown
- Improved adaptive deinterlacing

Support for the Next Generation of NVIDIA GPUs

Additional Details by Driver Module

DirectX

- Support for the next generation of GPUs
- Support for dual-core CPUs

OpenGL

- New Extensions
 - NV_packed_depth_stencil
 - ARB_pixel_buffer_object
 - GL_NV_timer_query
- Improved performance under Dualview
- Improved memory management for multiple open applications on Quadro workstation cards
- Improved performance with multiple overlapping windows
- Improved SLI performance
- Support for dual core CPUs
- Support for the next generation of GPUs

Video

Release 80 includes the following new PureVideo features and improvements:

- Improved inverse 3:2 implementation
- Improved inverse 2:2 implementation
- Adaptive Deinterlacing for HD content on GeForce 6600 and high GPUs
- PureVideo support for the next generation of GPUs

Classic NVIDIA Control Panel

- HDTV Overscan compensation support
Includes X-Y adjustment, and independent front-end timing adjustment features
- Dynamic SLI enable/disable capability

A P P E N D I X



MODE SUPPORT FOR WINDOWS

This chapter details the Windows modes supported by the Release 95 driver for NVIDIA products. It contains these sections:

- “General Mode Support Information” on page 28
- “Default Modes Supported by GPU” on page 29
- “Modes Supported by DACs and TV Encoders” on page 36

General Mode Support Information

The NVIDIA graphics driver includes a standard list of display modes that are supported by default. These modes are listed in the section “[Default Modes Supported by GPU](#)” on page 29.

The actual modes available depend on the capabilities of the display. In addition, the NVIDIA graphics driver has a “dynamic EDID detection” capability and will make available *additional* modes that are listed in the display EDID, provided the graphics hardware can support it.

The NVIDIA graphics driver also supports the high resolutions available with the displays listed in [Table A.1](#) as well as the non-standard modes listed in [Table A.2](#).

Table A.1 Modes Supported for High Resolution Displays

Display	Maximum Resolution	Hardware Requirements
Apple 30" Cinema HD Display (Dual link DVI)	2560x1600 @ 60Hz	<ul style="list-style-type: none"> All High-end NVIDIA Quadro FX (see list of products in “NVIDIA Quadro FX Family of High End GPUs” on page 30.)

Table A.2 Non-standard Modes Supported

Resolution
1680 x 1050
1366 x 768

Default Modes Supported by GPU

This section lists the modes that are included by default in the driver INF for the following product families:

- “NVIDIA Quadro FX Family of High End GPUs” on page 30

Understanding the Mode Format

Figure A.1 gives an example of how to read the mode information presented in this section.

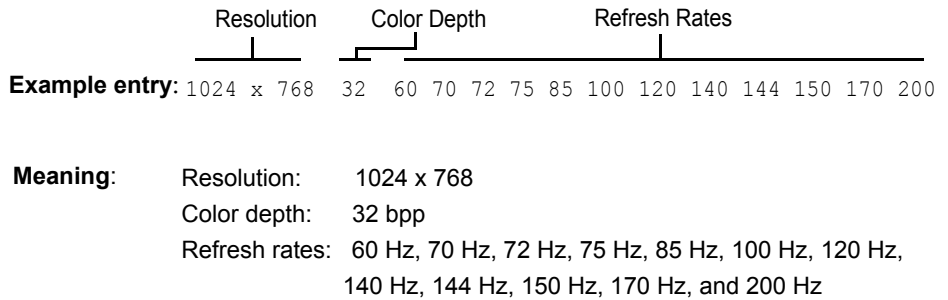


Figure A.1 Mode Format

Note:

- Horizontal spanning modes of 3840x1080 and above, and vertical spanning modes of 1920x2160 and above generally require at least 32 MB of video memory at 32 bpp.
- An “i” next to the refresh rate indicates an interlaced refresh rate.

NVIDIA Quadro FX Family of High End GPUs

This sections lists the supported display resolutions, color depths, and refresh rates for the following products:

- NVIDIA Quadro Plex 1000 Model I
- NVIDIA Quadro Plex 1000 Model II
- NVIDIA Quadro Plex 1000 Model III
- NVIDIA Quadro Plex 1000 Model IV
- NVIDIA Quadro FX 5600
- NVIDIA Quadro FX 4600

Standard Modes

320 x 200	8		60 70 72 75
320 x 240	8		60 70 72 75
400 x 300	8		60 70 72 75
480 x 360	8		60 70 72 75
512 x 384	8		60 70 72 75
640 x 400	8		60 70 72 75
640 x 480	8		60 70 72 75 85 100 120 140 144 150 170 200 240
720 x 480	8		60
720 x 576	8	50	60
800 x 600	8		60 70 72 75 85 100 120 140 144 150 170 200 240
848 x 480	8		60 70 72 75 85 100 120 140 144 150 170 200 240
960 x 600	8		60 70 72 75 85 100 120 140 144 150 170 200 240
1024 x 768	8		60 70 72 75 85 100 120 140 144 150 170 200 240
1088 x 612	8		60 70 72 75 85 100 120 140 144 150 170 200 240
1152 x 864	8		60 70 72 75 85 100 120 140 144 150 170 200
1280 x 720	8		60 70 72 75 85 100 120 140 144 150 170
1280 x 768	8		60 70 72 75 85 100 120 140 144 150 170
1280 x 800	8		60 70 72 75 85 100 120 140 144 150 170
1280 x 960	8		60 70 72 75 85 100 120 140 144 150 170
1280 x 1024	8		60 70 72 75 85 100 120 140 144 150 170
1360 x 768	8		60 70 72 75 85 100 120 140 144 150 170
1600 x 900	8		60 70 72 75 85 100 120 140 144 150
1600 x 1024	8		60 70 72 75 85 100 120
1600 x 1200	8		60 70 72 75 85 100 120
1920 x 1080	8	30i	60 70 72 75 85 100

1920 x 1200	8		60 70 72 75 85 100
1920 x 1440	8		60 70 72 75 85
2048 x 1536	8		60 70 72 75 85

320 x 200	16		60 70 72 75
320 x 240	16		60 70 72 75
400 x 300	16		60 70 72 75
480 x 360	16		60 70 72 75
512 x 384	16		60 70 72 75
640 x 400	16		60 70 72 75
640 x 480	16		60 70 72 75 85 100 120 140 144 150 170 200 240
720 x 480	16		60
720 x 576	16	50	60
800 x 600	16		60 70 72 75 85 100 120 140 144 150 170 200 240
848 x 480	16		60 70 72 75 85 100 120 140 144 150 170 200 240
960 x 600	16		60 70 72 75 85 100 120 140 144 150 170 200 240
1024 x 768	16		60 70 72 75 85 100 120 140 144 150 170 200 240
1088 x 612	16		60 70 72 75 85 100 120 140 144 150 170 200 240
1152 x 864	16		60 70 72 75 85 100 120 140 144 150 170 200
1280 x 720	16		60 70 72 75 85 100 120 140 144 150 170
1280 x 768	16		60 70 72 75 85 100 120 140 144 150 170
1280 x 800	16		60 70 72 75 85 100 120 140 144 150 170
1280 x 960	16		60 70 72 75 85 100 120 140 144 150 170
1280 x 1024	16		60 70 72 75 85 100 120 140 144 150 170
1360 x 768	16		60 70 72 75 85 100 120 140 144 150 170
1600 x 900	16		60 70 72 75 85 100 120 140 144 150
1600 x 1024	16		60 70 72 75 85 100 120
1600 x 1200	16		60 70 72 75 85 100 120
1920 x 1080	16	30i	60 70 72 75 85 100
1920 x 1200	16		60 70 72 75 85 100
1920 x 1440	16		60 70 72 75 85
2048 x 1536	16		60 70 72 75 85

320 x 200	32		60 70 72 75
320 x 240	32		60 70 72 75
400 x 300	32		60 70 72 75
480 x 360	32		60 70 72 75
512 x 384	32		60 70 72 75
640 x 400	32		60 70 72 75

640 x 480	32		60 70 72 75 85 100 120 140 144 150 170 200 240
720 x 480	32		60
720 x 576	32	50	60
800 x 600	32		60 70 72 75 85 100 120 140 144 150 170 200 240
848 x 480	32		60 70 72 75 85 100 120 140 144 150 170 200 240
960 x 600	32		60 70 72 75 85 100 120 140 144 150 170 200 240
1024 x 768	32		60 70 72 75 85 100 120 140 144 150 170 200
1088 x 612	32		60 70 72 75 85 100 120 140 144 150 170 200
1152 x 864	32		60 70 72 75 85 100 120 140 144 150 170
1280 x 720	32		60 70 72 75 85 100 120 140 144 150
1280 x 768	32		60 70 72 75 85 100 120 140 144 150
1280 x 800	32		60 70 72 75 85 100 120 140 144 150
1280 x 960	32		60 70 72 75 85 100 120 140 144 150
1280 x 1024	32		60 70 72 75 85 100 120 140 144 150
1360 x 768	32		60 70 72 75 85 100 120 140 144 150
1600 x 900	32		60 70 72 75 85 100 120
1600 x 1024	32		60 70 72 75 85 100
1600 x 1200	32		60 70 72 75 85 100
1920 x 1080	32	30i	60 70 72 75 85
1920 x 1200	32		60 70 72 75 85
1920 x 1440	32		60 70 72 75 85
2048 x 1536	32		60 70 72 75 85

Horizontal Spanning Modes

1280 x 480	8		60 70 72 75 85 100 120 140 144 150 170 200 240
1600 x 600	8		60 70 72 75 85 100 120 140 144 150 170 200 240
1696 x 480	8		60 70 72 75 85 100 120 140 144 150 170 200 240
1920 x 600	8		60 70 72 75 85 100 120 140 144 150 170 200 240
2048 x 768	8		60 70 72 75 85 100 120 140 144 150 170 200 240
2176 x 612	8		60 70 72 75 85 100 120 140 144 150 170 200 240
2304 x 864	8		60 70 72 75 85 100 120 140 144 150 170 200
2560 x 720	8		60 70 72 75 85 100 120 140 144 150 170
2560 x 768	8		60 70 72 75 85 100 120 140 144 150 170
2560 x 800	8		60 70 72 75 85 100 120 140 144 150 170
2560 x 960	8		60 70 72 75 85 100 120 140 144 150 170
2560 x 1024	8		60 70 72 75 85 100 120 140 144 150 170
2720 x 768	8		60 70 72 75 85 100 120 140 144 150 170
3200 x 900	8		60 70 72 75 85 100 120 140 144 150

3200 x 1024	8		60 70 72 75 85 100 120
3200 x 1200	8		60 70 72 75 85 100 120
3840 x 1080	8	30i	60 70 72 75 85 100
3840 x 1200	8		60 70 72 75 85 100
3840 x 1440	8		60 70 72 75 85
4096 x 1536	8		60 70 72 75 85

1280 x 480	16		60 70 72 75 85 100 120 140 144 150 170 200 240
1600 x 600	16		60 70 72 75 85 100 120 140 144 150 170 200 240
1696 x 480	16		60 70 72 75 85 100 120 140 144 150 170 200 240
1920 x 600	16		60 70 72 75 85 100 120 140 144 150 170 200 240
2048 x 768	16		60 70 72 75 85 100 120 140 144 150 170 200 240
2176 x 612	16		60 70 72 75 85 100 120 140 144 150 170 200 240
2304 x 864	16		60 70 72 75 85 100 120 140 144 150 170 200
2560 x 720	16		60 70 72 75 85 100 120 140 144 150 170
2560 x 768	16		60 70 72 75 85 100 120 140 144 150 170
2560 x 800	16		60 70 72 75 85 100 120 140 144 150 170
2560 x 960	16		60 70 72 75 85 100 120 140 144 150 170
2560 x 1024	16		60 70 72 75 85 100 120 140 144 150 170
2720 x 768	16		60 70 72 75 85 100 120 140 144 150 170
3200 x 900	16		60 70 72 75 85 100 120 140 144 150
3200 x 1024	16		60 70 72 75 85 100 120
3200 x 1200	16		60 70 72 75 85 100 120
3840 x 1080	16	30i	60 70 72 75 85 100
3840 x 1200	16		60 70 72 75 85 100
3840 x 1440	16		60 70 72 75 85
4096 x 1536	16		60 70 72 75 85

1280 x 480	32		60 70 72 75 85 100 120 140 144 150 170 200 240
1600 x 600	32		60 70 72 75 85 100 120 140 144 150 170 200 240
1696 x 480	32		60 70 72 75 85 100 120 140 144 150 170 200 240
1920 x 600	32		60 70 72 75 85 100 120 140 144 150 170 200 240
2048 x 768	32		60 70 72 75 85 100 120 140 144 150 170 200
2176 x 612	32		60 70 72 75 85 100 120 140 144 150 170 200
2304 x 864	32		60 70 72 75 85 100 120 140 144 150 170
2560 x 720	32		60 70 72 75 85 100 120 140 144 150
2560 x 768	32		60 70 72 75 85 100 120 140 144 150
2560 x 800	32		60 70 72 75 85 100 120 140 144 150
2560 x 960	32		60 70 72 75 85 100 120 140 144 150

2560 x 1024	32		60 70 72 75 85 100 120 140 144 150
2720 x 768	32		60 70 72 75 85 100 120 140 144 150
3200 x 900	32		60 70 72 75 85 100 120
3200 x 1024	32		60 70 72 75 85 100
3200 x 1200	32		60 70 72 75 85 100
3840 x 1080	32	30i	60 70 72 75 85
3840 x 1200	32		60 70 72 75 85
3840 x 1440	32		60 70 72 75 85
4096 x 1536	32		60 70 72 75 85

Vertical Spanning Modes

640 x 960	8		60 70 72 75 85 100 120 140 144 150 170 200 240
800 x 1200	8		60 70 72 75 85 100 120 140 144 150 170 200 240
848 x 960	8		60 70 72 75 85 100 120 140 144 150 170 200 240
960 x 1200	8		60 70 72 75 85 100 120 140 144 150 170 200 240
1024 x 1536	8		60 70 72 75 85 100 120 140 144 150 170 200 240
1088 x 1224	8		60 70 72 75 85 100 120 140 144 150 170 200 240
1152 x 1728	8		60 70 72 75 85 100 120 140 144 150 170 200
1280 x 1440	8		60 70 72 75 85 100 120 140 144 150 170
1280 x 1536	8		60 70 72 75 85 100 120 140 144 150 170
1280 x 1600	8		60 70 72 75 85 100 120 140 144 150 170
1280 x 1920	8		60 70 72 75 85 100 120 140 144 150 170
1280 x 2048	8		60 70 72 75 85 100 120 140 144 150 170
1360 x 1536	8		60 70 72 75 85 100 120 140 144 150 170
1600 x 1800	8		60 70 72 75 85 100 120 140 144 150
1600 x 2048	8		60 70 72 75 85 100 120
1600 x 2400	8		60 70 72 75 85 100 120
1920 x 2160	8	30i	60 70 72 75 85 100
1920 x 2400	8		60 70 72 75 85 100
1920 x 2880	8		60 70 72 75 85
2048 x 3072	8		60 70 72 75 85

640 x 960	16		60 70 72 75 85 100 120 140 144 150 170 200 240
800 x 1200	16		60 70 72 75 85 100 120 140 144 150 170 200 240
848 x 960	16		60 70 72 75 85 100 120 140 144 150 170 200 240
960 x 1200	16		60 70 72 75 85 100 120 140 144 150 170 200 240
1024 x 1536	16		60 70 72 75 85 100 120 140 144 150 170 200 240

1088 x 1224	16		60 70 72 75 85 100 120 140 144 150 170 200 240
1152 x 1728	16		60 70 72 75 85 100 120 140 144 150 170 200
1280 x 1440	16		60 70 72 75 85 100 120 140 144 150 170
1280 x 1536	16		60 70 72 75 85 100 120 140 144 150 170
1280 x 1600	16		60 70 72 75 85 100 120 140 144 150 170
1280 x 1920	16		60 70 72 75 85 100 120 140 144 150 170
1280 x 2048	16		60 70 72 75 85 100 120 140 144 150 170
1360 x 1536	16		60 70 72 75 85 100 120 140 144 150 170
1600 x 1800	16		60 70 72 75 85 100 120 140 144 150
1600 x 2048	16		60 70 72 75 85 100 120
1600 x 2400	16		60 70 72 75 85 100 120
1920 x 2160	16	30i	60 70 72 75 85 100
1920 x 2400	16		60 70 72 75 85 100
1920 x 2880	16		60 70 72 75 85
2048 x 3072	16		60 70 72 75 85

640 x 960	32		60 70 72 75 85 100 120 140 144 150 170 200 240
800 x 1200	32		60 70 72 75 85 100 120 140 144 150 170 200 240
848 x 960	32		60 70 72 75 85 100 120 140 144 150 170 200 240
960 x 1200	32		60 70 72 75 85 100 120 140 144 150 170 200 240
1024 x 1536	32		60 70 72 75 85 100 120 140 144 150 170 200
1088 x 1224	32		60 70 72 75 85 100 120 140 144 150 170 200
1152 x 1728	32		60 70 72 75 85 100 120 140 144 150 170
1280 x 1440	32		60 70 72 75 85 100 120 140 144 150
1280 x 1536	32		60 70 72 75 85 100 120 140 144 150
1280 x 1600	32		60 70 72 75 85 100 120 140 144 150
1280 x 1920	32		60 70 72 75 85 100 120 140 144 150
1280 x 2048	32		60 70 72 75 85 100 120 140 144 150
1360 x 1536	32		60 70 72 75 85 100 120 140 144 150
1600 x 1800	32		60 70 72 75 85 100 120
1600 x 2048	32		60 70 72 75 85 100
1600 x 2400	32		60 70 72 75 85 100
1920 x 2160	32	30i	60 70 72 75 85
1920 x 2400	32		60 70 72 75 85
1920 x 2880	32		60 70 72 75 85
2048 x 3072	32		60 70 72 75 85

Modes Supported by DACs and TV Encoders

This section lists the supported modes and formats for the following:

- “External DAC Mode Support” on page 36
- “TV-Out Mode Support” on page 37

External DAC Mode Support

Fairchild FMS3815 Modes Supported

Table A.3 shows the refresh rates for various resolutions of the Fairchild FMS3815 external DAC, which is commonly used on GeForce2 MX and Quadro2 MXR boards to drive a secondary CRT.

Table A.3 External DAC Modes (Fairchild FMS3815)

Resolution	Supported Rates (Hz)
640x480	60, 70, 72, 75, 85, 100, 120, 140, 144, 150, 170
800x600	60, 70, 72, 75, 85, 100, 120, 140, 144, 150, 170
1024x768	60, 70, 72, 75, 85, 100, 120
1152x864	60, 70, 72, 75, 85
1280x720	60, 70, 72, 75, 85, 100
1280x960	60, 70, 72, 75
1280x1024	60, 70, 72, 75
1360x768	60, 70, 72, 75, 85
1600x900	60, 70
1600x1200	—

Analog Devices ADV-7123 Modes Supported

Table A.4 shows the refresh rates for various resolutions of the Analog Devices ADV-7123 external DAC, which is commonly used on the GeForce2 MX and the Quadro2 MXR boards to drive a secondary CRT.

Table A.4 External DAC Modes (Analog Devices ADV-7123)

Resolution	Supported Rates (Hz)
640x480	60, 70, 72, 75, 85, 100, 120, 140, 144, 150, 170
800x600	60, 70, 72, 75, 85, 100, 120, 140, 144, 150, 170
1024x768	60, 70, 72, 75, 85, 100, 120
1152x864	60, 70, 72, 75, 85, 100
1280x720	60, 70, 72, 75, 85, 100
1280x960	60, 70, 72, 75, 85, 90

Table A.4 External DAC Modes (Analog Devices ADV-7123) (continued)

Resolution	Supported Rates (Hz)
1280x1024	60, 70, 72, 75, 85
1360x768	60, 70, 72, 75, 85, 100
1600x900	60, 70, 75
1600x1200	—

TV-Out Mode Support

Table A.5 and Table A.6 list the NTSC, PAL, and HDTV TV-Out modes supported by the NVIDIA driver.

Table A.5 Mode Support for S-Video and Composite Out

Resolution	Bit depth	Comments
320x200	8, 16, 32	DirectDraw mode; not selectable as a Windows desktop
320x240	8, 16, 32	DirectDraw mode; not selectable as a Windows desktop
640x400	8, 16, 32	DirectDraw mode; not selectable as a Windows desktop
640x480	8, 16, 32	
720x480	8, 16, 32	Overscans (for video)
720x576	8, 16, 32	Overscans (for video)
800x600	8, 16, 32	
1024x768	8, 16, 32	Conexant 25871 only

Table A.6 Mode Support for Component YPrPb Out and DVI Out

Resolution	Comments
480i (SDTV)	Supported on graphics boards with Conexant 875 or Philips 7108 TV encoders and compatible connectors, and compatible GeForce 6 Series and GeForce 7 Series GPUs.
480p (EDTV)	
720p (HDTV)	
1080i (HDTV)	
576i (PAL)	
576p (PAL)	

The driver supports manual overscan correction for component and DVI outputs. See the *ForceWare Graphics Driver User's Guide* for instructions on how to use the overscan correction features in the control panel.